i

CONTENT

About DigivibeMX® Version 11	4
¿What is DigivibeMX®?	4
Types of sensors	5
System requirements	5
Software Installation	6
Product Activation	6
Calibration	7
Other Configuration Menu Controls	10
Signal and Channel Preferences	10
Signal Tab	10
Channels Tab	11
Other Tab	11
Specify USB or WiFI Connected Interface (Portable Instruments Only)	12
Change language	13
Wiser VIBE Connection	14
Navigating DigivibeMX [®] Software	16
User interface	16
Menus and Modules	17
File Manager (All Digivibe Models)	17
Start Menu (All Digivibe Models)	18
Data Base Menu (M20, M30, Phantom)	19
Analyze Menu (All DigivibeMX Models)	20
Functions Menu (M20, M30, Phantom)	21
Alarms Menu (M20, M30, Phantom)	22
3D Menu (M20, M30, Phantom)	23
Phantom Menu (M30, Phantom)	24
Tools Menu (All DigivibeMX Models)	24
Configuration Menu (All DigivibeMX Models)	25
Help Menu (All DigivibeMX Models)	25
Routes Module (M20, M30)	26
Balancing Module (M10, M30)	27
Using DigivibeMX [®] Software	28
Start Tab	28
Start screen tiles	29
Open Files Tile (M20, M30, Phantom)	29
Tendency Tile (M20, M30, Phantom)	29
Extra Parameters Tile (M30, Phantom)	29
Analysis tile (M20, M30, Phantom)	30
Route (Open) Tile (M20, M30, Phantom)	30
Routes Manager Tile (M20, M30, Phantom)	30

Barcode Tile (M20, M30)	31
ODS Tile (M20, M30)	31
Balancing Single Plane Tile (M10, M30)	32
Balancing 2 Planes Tile (M10, M30)	32
Left-Hand Panel and Shortcut Tabs	33
Database Tab	34
Analysis Tab	35
Analysis and Work Area	37
Historic Measures Window (M20, M30, Phantom)	38
Internal RMS (M20, M30, Phantom)	41
Octave Bands (M20, M30, Phantom)	42
Open Multiple Files (M20, M30, Phantom)	43
Multiple File Selection (M20, M30, Phantom)	44
Dashboard Tendency Window (M20, M30, Phantom)	45
Using the Data Base Menu (M20, M30, Phantom)	47
Machine Toolbar	47
Creating a New Machine in the Database (M20, M30, Phantom)	48
Point Configuration	51
Assign a Bearing to a Measure Point	52
Assign a Gearbox to a Measurement Point	53
Assign Alarm Settings to a Measurement Point	54
Assign Extra Values to a Measurement Point	55
Connection Toolbar	57
El-Analytic Toolbar	58
Tools Toolbar	58
Using the Analyze and Functions Menus (M10, M30, Phantom)	59
New off-route analysis (M20, M30)	59
Start/Stop Data Collection	60
Viewing Vibration (M20, M30, Phantom)	61
Time Waveform/FFT Graph Tools (M20, M30, Phantom)	63
Units and FFT Spectrum Windowing (M20, M30, Phantom)	64
Analysis Menu Tools (M20, M30, Phantom)	65
Scope Tools	66
FFT Tools	67
TWF Tools	71
Functions Menu Tools (M20, M30, Phantom)	74
Single Channel Functions Toolbar	74
Dual Channel Functions Toolbar	77
Alarms Menu Tools (M20, M30, Phantom)	81
Show Alarms Toolbar	81
Configuration Toolbar	82

Setting an alarm envelope around a recording	82
3D Menu Tools (M20, M30)	86
ODS	86
ODS Modeling Requires Reference Channel Data	86
Adding a new 3D model to the database	87
Collecting Data for 3D Simulations (ODS)	91
Real ODS	94
Schedule Route	96
Analysis of ODS Data	98
Phase Analysis of ODS Data	100
Route Data Collection (M20, M30)	101
Advance Tendency (M20, M30, Phantom)	102
Data Panel	103
Severity Panel	104
Last Severities Avg Panel	105
Severity & Slope Panel	106
Trending Panel	107
Saving and Uploading Data Files	108
File Types	108
Saving Files	109
Opening Files	109
Phantom Menu Tools	110
Phantom Tools	110
Wizard	110
Status	113
Set Up Tools	114
Add GPIO Sensor	114
Power Off Configurations	114
Alarm Notifications	115
Reports	116
Product Registration	119

About DigivibeMX® Version 11

¿What is DigivibeMX®?

DigivibeMX[®] is a versatile, multi-functional software capable of analyzing machine vibration in real time, performing traditional route data collection and balancing single-plane or two-plane rotors – in-situ or on Soft Bearing Suspension balancing machines. The *DigivibeMX*[®] model purchased determines which software capabilities are available for the user.

- *DigivibeMX*[®] M10 provides dynamic balancing capabilities only
- DigivibeMX® M20 provides route and off-route vibration data collection and analysis capabilities only
- *DigivibeMX*[®] M30 combines the full balancing and vibration analysis capabilities of M10 and M20.
- DigivibeMX[®] Phantom supports remote machine health monitoring and analysis using our Phantom sensors.

DigivibeMX® combines powerful machine health monitoring tools with easy-to-use functions and easy-to-interpret visual interfaces. The software provides immediate capabilities for inexperienced users, and more sophisticated tools for experienced users seeking a full range of analysis capabilities.

Functions include:

- Real-time vibration waveform and FFT spectrum analysis
- Single-plane or two-plane dynamic rotor balancing with weight calculator
- Balancing Wizard enables Soft Bearing Suspension dynamic balancing without trial weights
- Automatic RPM filtering
- Orbital Analysis
- Circular Time Waveform signal rendering
- Automatic generation of vibration analysis and balancing reports (compatible with Microsoft Word and Excel 2007)
- Powerful SQL database
- Accuracy up to +/- 0.1 RPM
- Up to 2 million lines of resolution
- ODS simulation features built into the software, compatible with imported .obj .xaml and .3ds modeling files
- ISO or customizable band alarms for Velocity and Acceleration Enveloping
- Individual enveloping alarms for establishing machine baselines
- Trigger recording
- Simultaneous or sequential recording of 2 planes for dynamic balancing.

DigivibeMX[®] Is distributed with electronic equipment and optional accessories approved by **Erbessd Instruments**[®].

Visit our page for more information on available equipment. http://www.erbessd-instruments.com

Types of sensors

DigivibeMX®v11 wired interface systems include the following sensors:

100 mV/G Accelerometers:

Vibration sensors. Their output voltage is proportional to the acceleration of vibration. Used for:

- Dynamic Balancing in 1 and 2 planes
- Vibration Analysis
- Route Data Collection
- Capturing ODS modeling data

Laser Optical Sensor:

Laser-emitting speed sensor:

Used for:

- Measuring rotational speed (CPM or Hz)
- Dynamic Balancing (Phase Angle)

System requirements

Minimum requirements of a desktop, laptop or tablet computer* for *DigivibeMX*® v11 software installation: * Not compatible with Windows RT operating system

- Intel® Celeron® (2.50 GHz / 400MHz) or higher
- Minimum 4GB DDR2 or higher RAM
- Windows 10 (*supports Windows 8 and 8.1)
- SVGA or higher monitor (enhanced for touch screens)
- 750 MB of minimum disk space
- 1 USB 2.0 port
- Internet connection (for software installation and activation only)

Other Required Software:

- MySQL Connector Net 6.5.4 (Included with system purchase)
- SQL Compact server 3.5 SP2 (Included with system purchase)
- Microsoft Word 2007 or higher (for reporting features)
- Acrobat Reader 7.0 or higher (for opening help guide)



Software Installation

From USB or Download: Open the DigivibeMX® folder location in Windows Explorer:

- 1. Open and install SSCERuntime_ (x64 for 64-bit operating systems; x86 for 32-bit operating systems)
- 2. Open and install setup.exe

	Name	Date modified	Туре	Size
	😾 Digivibe.msi	10/10/2018 4:15 PM	Windows Installer Pa	111,634 KB
	뤻 mysql-connector-net-6.5.4.msi	8/19/2015 11:04 AM	Windows Installer Pa	13,112 KB
	read me.txt	4/26/2018 11:51 AM	Text Document	1 KB
2	🐼 setup.exe	10/10/2018 4:14 PM	Application	459 KB
1	🖶 SSCERuntime_x64-ENU.msi	2/11/2010 8:36 PM	Windows Installer Pa	3,568 KB
- 1	🖶 SSCERuntime_x86-ENU.msi	2/11/2010 8:36 PM	Windows Installer Pa	3,090 KB
	<pre>wcredist_x64.exe</pre>	4/26/2018 10:54 AM	Application	2,319 KB
	🥰 vcredist_x86.exe	4/26/2018 10:33 AM	Application	1,779 KB

Product Activation

IMPORTANT: Activating *DigivibeMX*® software requires an Internet connection!

Upon first launch of *DigivibeMX*®, you will receive the following message. Click **Yes** to register:

Digivibe 11		
DigivibeMX has expired. V	Nould you like to register y	our copy now?
	Yes	No

Enter your Username and Activation code. Click Activate:

Activation	- 0	×
User	Your Usemame	
Activation code	YOUR-LICE-NSE -KEY	
	an active internet connection in nce ready please press Activate	

Enter your username and activation code in the corresponding boxes.

The key consists of 16 characters, for example WWWW-YYYY-WWWW-YYYY (do not include dashes).

Important: An active internet connection to the Erbessd licensing server is required to activate the software. Sometimes industrial, business or university networks prevent connection due to firewalls. If this occurs, you will receive an SQL error message. If necessary, consider activating the software from a different network (personal cellular network, for example).

Calibration

The following Erbessd Instruments interfaces and wireless devices are pre-calibrated on their chipsets. They do not require calibration in *DigivibeMX*® software:



The following legacy wired interfaces must be calibrated in *DigivibeMX*® before performing vibration analysis or dynamic balancing. Calibration data is unique and specific to each individual interface. Therefore, it is also necessary to ensure the interface being used is correctly identified in the software before collecting data. Otherwise, collected data will likely be displayed inaccurately. This procedure is required during initial product activation. It will also be necessary to recalibrate if you ever upgrade *DigivibeMX*® software, modify the initial calibration file or completely reformat the computer.



INT2-15A (I-500)



effitient interface)

0

INT2-16A/INT2-17A (I-600/I-700)

INT4-18x (I-800)

ERBESSD INSTRUMENTS

To calibrate: Connect the 2 or 4 channel interface to the computer via USB. Connect the calibration device to the Op port using the 5-pin Tachometer cable, as shown. Ensure the computer recognizes that a new device has been installed.



On the *DigivibeMX*[®] **Configuration** menu, click **Select Device** and verify that *DigivibeMX*[®] detects the connected interface. If no device is found, exit the software, check all connections, restart *DigivibeMX*[®] and recheck.



Confirm the interface is detected by DigivibeMX® and click Accept

Select device		X
EI-Digivibe (8- US	B Multi-Channel Aud	lio Device)
EI Wiser 3X		

On the **Configuration** menu, click **Calibration**

D 🐸 🔽	÷			Dig	givibeMX <mark>M</mark> 3	0 - 11.30				[0]	_] c	x
	Start Data	Base Analy	ze Fun	ictions Envelope	Alarms 30	Phantom	Tools	Configuration	Help			
<u>.</u>	ABC	M		Ŷ	WESER							
Preferences	Change Language	Calibration	Select Device	USB Connection	Connect to WiserVibe							
Settin	gs "			Device	4							\diamond

The Calibration window opens. Select your Interface. Select the Channel to which the Calibration device is connected. Then click **Calibrate**.

If your interface is connect it to deter		y to disconnect	If your interface is connected and reconnect it to detect aut		to disconnect
After that, select the cha	annel to which your	calibration	After that, select the channel	to which your ca	libration
Interface			Interface IN	T2-I6A 💌	
Channel	 INT2-I5A		Channel 2	•	
Calibrate	INT2-16A INT2-17A INT4-18x	Close	Calibrate		Close

The following screen confirms a successful calibration. *DigivibeMX*® is now ready for use with the calibrated interface.

If your interface is co and reconnect it to d			sary to disconnect
After that, select the		X	ur calibration
	Calibration	succeeded	
	0	к	
Interfa			
Channel	2	•	

Other Configuration Menu Controls

Signal and Channel Preferences

Users should review the Signal and Channels settings in **Preferences** and make desired changes, before attempting to record or analyze data. Open the **Configuration** Menu and select **Preferences**:



The Preferences window opens, containing three tabs for user-defined options

Signal Tab

The Signal tab is used to specify default data recording, filtering and display parameters

- **Time (secs):** This tool is very usefull to calculate resolution lines depending on a defined time. This way the selection of resolution lines will be more precise.
- Resolution Lines: Specifies the default lines of resolution for data collection. Detailed information about how the specified Resolution Lines affect Resolution Points and Frequency Range are also displayed. Adjustments can be made for specific data collection points when creating Routes, as desired.
- RMS Filter Hz: Sets RMS filter rage. Default is 11-11000 Hz.
- **Low Frequency Filter button**: Toggles the low-frequency filter ON or OFF. Eliminates the low frequency ski-sloping and haystacking noise traditionally seen in FFT displays.
- Units: Select between Imperial or Metric default units.
- **FFT Frequency**: Select between Hz, CPM or Orders default units.
- **Type Interface**: Identifies the current or most recent DigivibeMX Interface model connected. Should be confirmed prior to data collection.
- Advance Settings: Enables the Calibration settings portion of the Signal tab, if applicable. It is not recommended to make any adjustments to these settings without the assistance of an Erbessd Instruments support engineer, as changes to these settings will affect the accuracy of connected interfaces.

Signal Channe	ls Other		
Recording paramet	ers		
Time (secs)	5 Get	LoR	Resolution Points Resolution Lines: 51200
Resolution Lines	51200	-	Recording Samples: 240000
RMS Filter Hz	11 🛟		Recording Time (s): 5
Remove DC			Frequency Range
Low free	quency filter ON		2.344 Hz/p 7200000 CPM
Units	Imperial		140,63 CPM/p
FFT Frequency	CPM		
, in the second s	Scopes attach		
Type Interface	INT4-GX4	+	
Sample Rate	48000	-	Advance Settings
Calibration			
Wired WiSER	1x WiSER 3x		PreAmp
j.	Vibration		30
	0 ≑		Save
Actual Value			
Actual Value	0,3 🖕	Save	

Channels Tab

The Channels tab is used to specify sensor Type and Sensitivity for up to 4 channels.

NOTE: Sensitivity, Type and Trigger controls are inactive until a channel is selected. Channel 3 is inactive with the wired GX-400 interface, unless the optional splitter cable is used.

- Sensitivity: Specifies the sensitivity for the installed sensor. Unless specialty accelerometers are specified, all Erbessd Industries accelerometer device sensitivity is 100 mV/g. The Laser Optical Sensor sensitivity is 130 mV/g.
- **Type:** Identifies whether the sensor is an Accelerometer, Velocimeter, Proximity Probe or Optical Sensor
- Trigger: Toggles default vibration trigger setting between Active or Inactive (portable instruments only).

Signal	Cha	nnels	Othe	er					
Chann	el	~							
		Sens	itivity	13	0	+	mV/g		
			Туре	Optical	Sensor	-			
				Trigge	r Inactive			1	Modify
Chann	el 1				Cha	nne	12		
Sensiti	vity:	100		mV/g	Sen	nsitivi	it <mark>y:</mark>	100	mV/g
Т	ype:	Acce	lerome	ter		Ту	pe:	Acceler	ometer
Trig	ger:	Inac	tve			Trigg	ger:	Inactve	
Chann	el 3				Cha	nne	4		
Sensiti	vity:	100		mV/g	Sen	sitivi	ity:	130	
т	ype:	Acce	lerome	ter		Ту	pe:	Optical	Sensor
Trig	ger:	Inac	tve		1	Trigg	ger:	Inactve	

Other Tab

Allows the Phantom menu to be displayed or hidden, as desired.

Signal	Channels	Other	
Phantom	Options		
1	hantom Menu		

Specify USB or WiFi Connected Interface (Portable Instruments Only)

At the current time, all Erbessd Instruments portable instruments except WiSER3x require USB Connection.



To use the WiSER3x with DigvibeMX, click to change USB Connection to WiFi Connection. Then, press the button on your WiSER3X and connect to the EIWiSER network on your computer.



Once that you're connected to the EIWISER network, click the "Connect WiFi" button that is on the Configuration tab or in the Analyze tab.

Ī	D 🧉 🐷	Ŧ			D	igivibeMX N	130 - 11.30				(P)	(_) D)	×	
	1 9	itart Data B	ase Analyze	e Function	s Envelop	e Alarms	3D Phant	om To	ols Configu	iration Help				
	e-	ABC	NA		1	<i>6</i>	WEE							
	Preferences	Change Language		Select Wifi Device	Connection		Connect to WiserVibe							
	Setting				Device								\diamond	
							1122							
≓_ ∓ ∏_ Start 0	ata Base Analyze	Functions Enve	lope Alarms 3D	Phantom To	ols Configura	ition Help	DigivibeMX M30	- 11.26						
F		•	C1 @		mm/s	Hz 0	ON I.	Ī	📙 Save	📙 Save		Horizontal		Horizonta
w Analysis Connect Wifi	Stop Real Time	Trigger	Channels Add th	annel Delete V	Vindow Units	Freq 1000	Notes Marker	Clear	Read and	iff Load	FFT Tools	1 Vertical	TWF Tools	1 Vertical
- 14	leasure	a Sound	Chenno	als 4	Patami	eters 2	Markats	4 0	ummon Markers	Specific Markers		FFT Distance		TWF Distance

The software will let you know once your device is connected.

D

D 🐸 🔄	Ŧ			Di	givibeMX M30 -	11.30				×
	Start Data	Base Analy	ze Fur	nctions Envelope	e Alarms 3D	Phantom	Tools	Configuration	Help	
C. 33	ABC	M	Q	(\checkmark	WISER				
Preferences	Change Language	Calibration	Select Device	Wifi Connection	Wifi Connected	Connect to WiserVibe				
Settin	gs 🎍			Device						~

Change Language.

DigivibeMX new characteristic is that now it's multilingual. The language change can be done through the "Configuration" Menu with the "Change Language" button.



This will open the language selection window. Here you will see the option to change the language of all the interface into Spanish, English, French and Russian.

English Españo Françai Русскиі	s	
	w always at selected lar	s default


When changing the language the software will need to restart so it will notify when making this action and it will automatically restart.

WiSER VIBE Connection.

DigivibeMX now allows to create a direct connection and share information through the WiSER VIBE app. With the "Connect to WiSERVibe" button it's possible to transfer all of the recordings storage on your iOS device.

D 🐸 💀	Ŧ			Di	givibeMX M30	- 11.30				
	Start Data	Base Analy	ze Fur	nctions Envelope	e Alarms 3D	Phantom	Tools	Configuration	Help	
	ABC	AA		÷	WESER					
Preferences	Change	Calibration	Select	USB Connection	Connect to					
rielelences	Language	Calibration	Device	▼	WiserVibe					
Settin	gs "			Device	4					\$


Pressing this button will generate a QR code from DigivibeMX and with WiSER VIBE, with the option "QR Connect", scan the code.

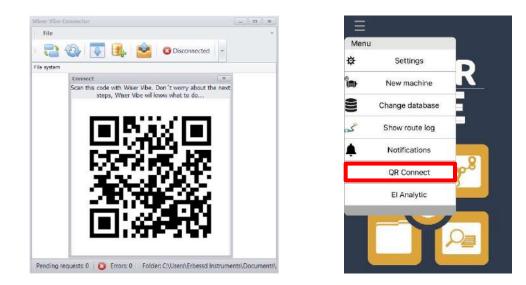

When scanning the code the link between DigivibeMX and WiSER VIBE is created and in the main window will appear a "Connected" notification. Now all of the information storaged on your iOS device will be available on DigivibeMX.

Device:	_ 🗆 🗙
File	
■ 🔁 🚱 💽 🏨 🔷 Connected 🔹	
File system	
• 🗌 🚾 2020-09-22 15-26	
+ 🗌 💻 2020-09-11 12-53	
OR-2020-09-11 12-53-00anl	
+ 🗔 🚾 2020-09-11 09-55	
▶ □ = 2020-09-11 09-39	
Pending requests: 0 🔞 Errors: 0 Folder: C:\Users\Erbessd Instruments\Documents\Erbessd Instruments 11\Wis	erVibe Files

In the "Device" window you can find the next buttons:

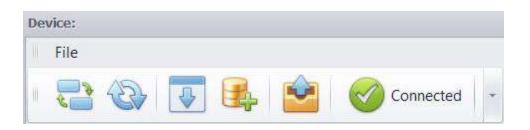

- Connect: Generate a new QR code to connect to DigivibeMX through WiSER VIBE.
- **Refresh:** Updates de list with information on screen.
- **Download selected files:** Allows to download selected recordings from the list to an .anl file.
- **Download to database:** Allows to download selected recordings from the list directly to a point in the database.
- Add route: Allows you to add routes from DigivibeMX to WiSER VIBE.


Navigating DigivibeMX® Software

User Interface

DigivibeMX® version 11 has maintained a classic Windows-style appearance. The software is still organized by Menus. Each Menu still features toolbars with control buttons. However, *DigivibeMX®* version 11 has been specifically redesigned to be more portable and touchscreen friendly than previous versions.

The User Interface is divided into 3 main sections:

- Section 1: Menus and Toolbars
- Section 2: Data Tree and Shortcut Tabs (Start Menu) / Signal Values (Analysis Menu M20, M30, Phantom)
- Section 3: Quick-launch Tiles (Start Menu) / Analysis and Work Area for other software functions

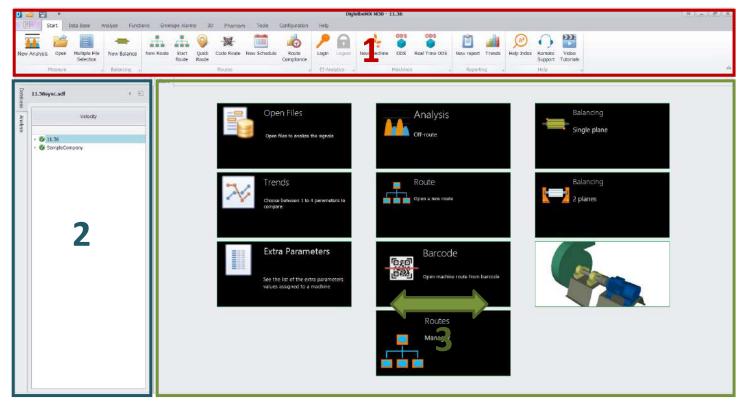

Depending upon computer screen resolution, all Quick-launch Tiles displayed here may not be visible. The entire panel may be scrolled laterally to view tiles. If using a mouse, roll the scroll wheel or click and drag the panel. On touchscreen devices, simply slide the panel with your finger. Tiles may be rearranged as desired.

Also, some tiles above may not be available, depending upon the software model purchased. For example: The above image represents M30 software with all available features. M10 does not have Database, Vibration Analysis, Routes or ODS features. M20 Does not have Dynamic Balancing features. Phantom does not have Dynamic Balancing or Route features.

Menus and Modules


The graphic user interface of *DigivibeMX*® Version 11 has been completely redesigned with more intuitive menu options, increased touchscreen compatibility and easier access to functions. Key operations such as Dynamic Balancing and Route Data Collection now launch in separate modules. Certain menus and modules may not be available, depending upon the software model purchased.

MENU	M10	M20	M30	PHANTOM
File Manager	√	\checkmark	\checkmark	\checkmark
Start menu	\checkmark	\checkmark	\checkmark	√
Data Base menu		√	√	√
Analyze menu	\checkmark	\checkmark	\checkmark	\checkmark
Functions menu		√	√	\checkmark
Alarms menu		√	√	√
3D (ODS) menu		√	√	
Phantom menu			√	√
Tools menu	√	√	√	√
Configuration menu	√	√	√	√
Help menu	√	√	√	\checkmark
Balancing module	V		√	
Routes module		√	√	

File Manager [1] (All Digivibe Models)

The File Manager button opens File Manager options to:

- Launch one of several New common tasks
- Open a recorded file or database
- Save an off-Route vibration recording into the current database or as an independent file.

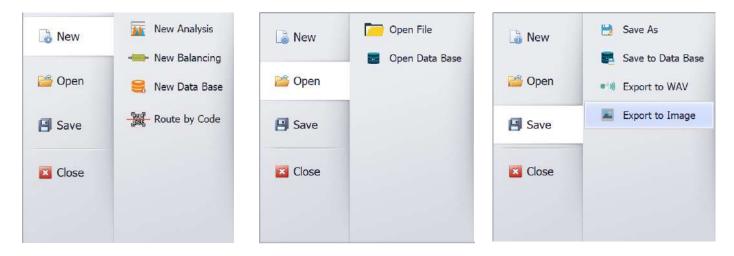

Start Menu (All Digivibe Models)

Options and control buttons on the Start Menu will vary depending on the software model purchased. The picture below represents M30 with all available features.

2 😂 🖾								1	DigivibeMX M3	0 - 11.36								- (Ø)	- 0	26
	itart i	Data Base 🛛 🗸	Analyzo Funct	ions Erivel	lope Alarn	15 3D	Phanton	n Tools	Configuration	Help										
T	P		-	-	đ.	0	- 010 640		6	۶	0	-	ODS	ODS	Ê		Ø	0	***	
lew Analysis	Open	Multiple File Selection	New Balance	New Route	Start Route	Quick Route	Code Route	New Schedule	Route Compliance	Login	Logout	New Machine	ODS	Real Time ODS	New report	Trends	Help Index		Video Tutorials	
	Measure		Balancing				Routes			EI-An	alytics		Machine	s .	Reports	10		Help		4

Measure toolbar

- New Analysis: Starts a new off-Route Vibration Analysis recording session. Opens the Analysis Menu and Waveform/FFT window in the Analysis and Work Area (M20, M30)
- Open: Opens a File Explorer window for navigating to and opening a saved Vibration Analysis recording file (All DigivibeMX models)
- **Multiple File Selection**: Allows you to select measurements from any machine so you can open it on different channels on the same plot.
- New Balance: Starts a new Dynamic Balancing session and launches the Balancing module (M10, M30)

Routes toolbar (M20, M30)

- **New Route**: Launches the Route creation window. Used to create new Vibration Analysis Routes from available machines in the current database
- **Start Route**: Launches the Route data collection module. Used load and collect an existing Vibration Analysis Routes for machines in the current database
- **Quick Route**: Allows the collection of a route without previously modifying it or creating a name and group.
- **Code Route**: Launches the Route to collect an existing Vibration Analysis Route by scanning machine barcodes assigned in DigivibeMX
- **New Schedule**: Launches the Schedule window to create a new programed route in a specific period of time.
- **Route Compliance**: Launches the graph compliance windows where the information of the routes taken and not taken is shown.

EI-Analytics toolbar

- Login: Opens the Login window for El-Analytics (subscription service)
- Logout: Logs out of El-Analytics (subscription service)

Machines toolbar

- New Machine: Creates a new Machine in the database (M20, M30, Phantom)
- **ODS**: Starts a 3D ODS simulation session. (**M20, M30, Phantom**)
- **Real ODS**: Starts an off-route 3D ODS simulation session. (M20, M30, Phantom)

Reports toolbar (All DigivibeMX models)

- New Report: Launches the Reports module
- **Trends**: Opens the statistical data Dashboard window for the current database in the Analysis and Work Area (**M20**, **M30**, **Phantom**)

Help toolbar (All DigivibeMX models)

- **Index:** Opens a link to the Erbessd Instruments user manual.
- **Online Help**: TeamViewer QuickSupport download link, allowing Erbessd Instruments technical support engineers to assist via remote access.
- Video Tutorials: Opens a link to the Erbessd Instruments Youtube channel.

Data Base Menu (M20, M30, Phantom)

D 🐸 🔚	•							Digivibe	MX M30 -	11.33				32 _ 0 X
E- st	art Data B	ase /	Analyze	Functions E	nvelope Ala	rms 3D	Phantom	Tools	Configur	ation	Help			
	1	8				B	0	1	0	Q	1			
New machine	Edit machine	Delete machine		New database	Connect	Refresh	Synchronize	Login	Logout	Explore	Ublibes	Database Size	Delete Measures	
	Machine		-	CO	inection		Synchronize	EI-An	alytics		1	ools	1	A

Machine toolbar

- New: Opens the window to create a New Machine in the current database
- Edit: Opens the window to Edit a selected machine in the database
- Delete: Deletes selected (check marked) Sites, Areas or Machines from the database.
- **Notes**: Opens a window to create a tool-tip style note at the machine or point level in the database

Connection toolbar

- New: Opens a File Manager window to create a new SQL database
- **Connect**: Connects DigivibeMX to a different SQL, SQLCe or MySQL database
- Refresh: Updates the database with the latest changes made

Synchronize toolbar

• **Synchronize**: Allows transferring data from one database to another, from a local database to a cloud based database or vice versa.

EI-Analytics toolbar

- Login: Opens the Login window for El-Analytics (subscription service)
- Logout: Logs out of El-Analytics (subscription service)

Tools toolbar

- **Explore**: Opens a window to Explore the SQL database tables*
- **Utilities**: Opens a toolbar with options to Update a database version, Repair a database, Compact a database, or Open the database importer.
- Database Size: Calculates the size of your current database.
- Delete Measures: Delete Manager tool that allows to remove information of the database in a selected time period.

*Do not use this feature unless you have knowledge on SQL databases.

Analyze Menu (All DigivibeMX Models)

l 🧉 🖪													Digi	vibeMX k	130 - 11.3	36							(.×.)=	1012
E sta	nt Da	ta Base	Analyze	Function	ns Enve	ope Alarms	30 Phi	entom	Tools	Configura	nation	lielp :												
	6	۰	۲	۲	×	C1	0	0		in/s	СРМ	100	B	1	L	Î	🛃 Save	📕, Saro			Horizontal		Horizontal	
lew Analysis	Connact Wifi	stup	Roal Time	Trigger		Channels *	adil channel	Delota	Window *	Units *	Fraq *	sok *	1	Notes	Marker *	Clear *	ile Lord	tosi 🚞	Scope Tools •	FFT Tools	1 Vertical	TWF Tools	1 Vertical	
	Ma	anure			Sound		Channels	-		Fact	maters				Markors		Conimon Mankers	Specific Markers			FFT Distance		TWF Distinct	1

Measure toolbar

- **Record**: Starts a manual off-route data recording
- **Stop**: Ends a manual off-route data recording or live, real-time recording
- Real Time: Starts a live, real-time recording
- **Trigger**: Sets a recording to begin when the preset Trigger vibration threshold is reached

Sound toolbar

- Play icon: Plays the audio of a displayed vibration data collection
- **Stop icon**: Ends audio playback of a displayed vibration data collection

Channels toolbar

- Channels: Selects the number of channels to record for an off-route data collection
- Add Channel: Adds another channel of data from the database or external file for comparison
- **Delete:** Removes one channel of data from de database.
- **50K:** Allows the user to change the displayed unit scale of the CPM graph. You can choose between 10K, 30K, 50K, 100K and 300K.

Parameters tools

- Window: Allow the user choose between the 8 FFT configurations
- Units: Allow the user change the amplitude units for the FFT and TWF
- Frequency: Allow the user to change the frequency of FFT (CPM, Hz Orders)
- **Save Personal Configuration:** Allows to save specific set up defined by user for the type of units, zoom, windowing for the TWF and FFT.
- **Remove Personal Configuration:** Deletes the set up previously defined by the user and configures de default options.

Markers toolbar

- **Notes**: Opens the window to create a tool-tip style note
- Marker: Allows the user to place custom markers on the Time Waveform or FFT
- Clear: Clears all markers from the Time Waveform or FFT

Common Markers toolbar

- **Save**: Saves all markers placed on the Time Waveform or FFT to be recalled later for other signals
- Load: Loads previously saved common markers to be displayed on the signal

Specific Markers toolbar

- Save: Saves all markers placed on the Time Waveform or FFT to the currently viewed signal only
- Load: Loads previously saved specific markers to be displayed on the signal

Scopes toolbar

- Panelized: Allows to distribute the different channels on separate scopes.
- **Range Selector**: Graph that shows the whole spectrum for both scopes (FFT and TWF) and lets you define the range of data shown in the main scope.
- Visible Legends: Remove/Show the information presented in the square on the right of the scope.

FFT Tools toolbar

- Harmonics: Displays 1 10 harmonic marker lines from a selected point in the FFT
- Sidebands: Displays 1 4 sideband marker lines from a selected point in the FFT
- **Averages:** Recalculates the FFT using up to 10 averages (default view is 1)
- **Overlap:** Allows the user to overlap the FFT up to 90 times
- **Decibels:** Displays the FFT in Db amplitude

FFT Distance toolbars

- Horizontal: Allows the user to measure between two points horizontally in the FFT
- Vertical: Allows the user to measure between two points vertically in the FFT

TWF toolbar

- **Transient:** Displays interval sideband markers from a selected point in the Time Waveform
- **Circular TWF:** Displays the Time Waveform in a circular pattern based on a selected frequency

TWF Distance toolbars

- Horizontal: Allows the user to measure between two points horizontally in the TWF
- Vertical: Allows the user to measure between two points vertically in the TWF

Functions Menu (M20, M30, Phantom)

NOTE: The Functions Menu contains tools for advanced Time Waveform and FFT analysis. A recorded signal should be opened for analysis before proceeding to the Functions Menu.

D 📸	-					Digiv	vibeMX I	130 - 11	.20				
	Start	Data Base	Analyze	Function	s En	velope Ala	arms	3D I	Phantom	Tools	Configuration	Help	
2			A.	Mit	P	w	<u></u>	th	mm				
Circular TWF	Waterfall	Spectrogram	Frequency 0	FFT	Bode	Phase	Cross	FRF	Coherence	Orbit	Cascade		
	Single	e Channel Funct	tions				Dual	Channel	Functions		4		\diamond

Single Channel Functions toolbar

- **Circular TWF:** Displays the Time Waveform in a circular pattern based on a selected frequency
- Waterfall: Displays a cascading 3D FFT representation of the vibration signal
- **Spectrogram**: Color representation of signal amplitude
- **Frequency 0**: Frequency calculation based on the time elapsed between crossings of 0 axis
- **FFT**: Amplified frequency spectrum

Dual Channel Functions toolbar

- Bode: Bode chart for calculating resonant frequencies
- **Phase**: Graphic that represents the Phase in each frequency of the whole spectrum
- **Cross**: 2 signal crossing function to weight matching frequencies
- **FRF** (Frequency Response Function): Measures the output spectrum of a system in response to a stimulus
- Coherence: Statistics to examine the relationship between 2 data collections
- **Orbit**: Dynamic 2D representation of rotor shaft displacement
- **Cascade**: Displays a 3D cascade graph of several waveforms or FFTs (highlight multiple desired readings in the Historic Measures screen to activate Cascade)

Alarms Menu (M20, M30, Phantom)

NOTE: The Alarms Menu contains tools for setting envelope alarms around the FFT of a recorded signal. The desired recording should be opened before proceeding to the Alarms Menu.


D 🐸 🔻				DigivibeM	(M30	- 11.20				(E) _ O	X
St.	art Data	Base A	Analyze Functions	Envelope Alarms	3D	Phantom	Tools	Configuration	Help		
Show alarms	Green Yellow Red	Report	Set Alarms								
Show Ala	rms _	Config	guration "								6

Show Alarms toolbar

- Show All Alarms: Displays all envelope alarms set on the current recording (if any)
 - **Green**: Displays or hides the lowest level alarm envelope
 - Yellow: Displays or hides the mid-level alarm envelope
 - **Red**: Displays or hides the highest level alarm envelope

Configuration toolbar

- **Report**: Displays alarm levels set at each monitoring point and axis on the machine to which the current recording belongs
- **Set Alarms**: Uses the current recording's FFT to set envelope alarm parameters that will be applied to each recording at that monitoring point (select Set Alarms, click Wizard)

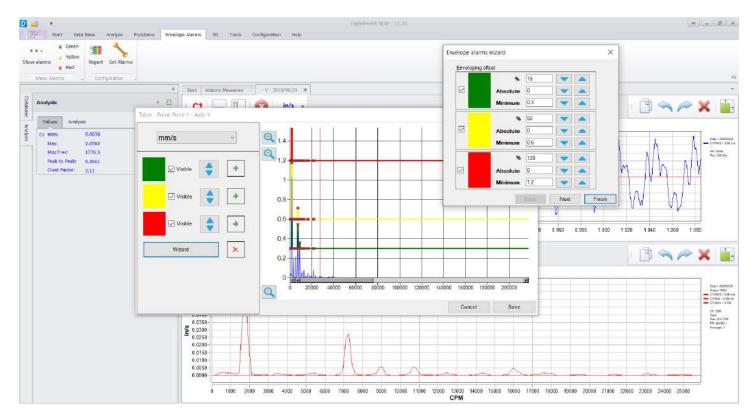

3D Menu (M20, M30, Phantom)

D 🐸	Ŧ						Digivibe	1X M30 -	11.08		
	Start	Data Base	Analyze	Functions	Alarms	3D	Phantom	Tools	Configuration	Help	
ODS ODS) Play	Pause Stop	p Down	Up	Decrease	Amplify	Сору	GIF			
Create "	P	lay ODS		eed "	Amplit	ude	a Too	ls ,			۵

Create toolbar

ODS: Opens the 3D ODS simulation Control Panel for a selected machine in the database (select ODS configured machine from the database, select 3D Menu, select ODS)

Play ODS toolbar

- Play: Starts movement of the 3D ODS simulation
- Pause: Pauses the simulation
- **Stop**: Stops the simulation

Speed toolbar

- Down: Decreases the simulation speed
- **Up**: Increases the simulation speed


Amplitude toolbar

- **Decrease**: Decreases amplitude of the simulation movement
- Amplify: Increases amplitude of the simulation movement

Tools toolbar

- **Copy**: Export the 3D ODS simulation as a still image file
- **GIF**: Export the 3D ODS simulation as a moving GIF file

NOTE: For detailed instructions about using 3D ODS functions, please refer to Page 128.

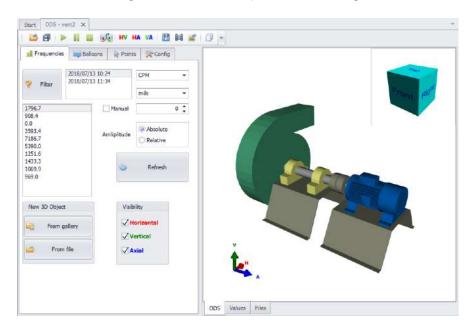

Phantom Menu (M30, Phantom)

D 📸	₹					Dig	ivibeM	X M30 - 11.24	ki.			[0]		х
	Star	t Data B	ase Ana	lyze Function	ns Er	nvelope Alarms	3D	Phantom	Tools	Configuration	Help			
	6	(I)	0	Z										
Wizard	Status	Signal Strength	Add GPIO Sensor	Power Off Configurations	Alarms Set up									
	Phantom	4		Set up										\diamond

Phantom toolbar

- **Wizard**: Opens the Phantom Configuration Wizard
- **Status**: Opens the Phantom status window to view a Phantom sensor's current state
- **Signal Strength**: Displays a list of sensors connected to the Gateway. By selecting a sensor, it shows the signal strength for that specific sensor.
- Add GPIO Sensor: Opens the Sensors for GPIO window. In this window you can set accelerometers, proximeters and velocimeters.
- Power Off Configurations: Allows to set an activity period for sensors with machines that do not met a required value.
- Alarms Set Up: Creates an alarm value for collected data.

Tools Menu (All DigivibeMX Models)

D 📁 🛛						Digiv	ribeMX M30	- 11.32					
I ~	Start	Data Base /	Analyze	Functions	Envelope Alarm	s 3D	Phantom	⊤ools	Configur	ation	Help		
ISO	gī				°Ö	Ċ.	UFF58	ASCII	csv	UFF58	ASCII	CSV	
ISO 10816	Envelope	Print Machine Codes	3D Model Editor	Bearings Info	Gear Frequency	Advance Tendency	Export To UFF58	Export To ASCII	Export To CSV	UFF58 Import	Import ASCII	CSV Import	
Severi	ties			Extras				Exports			Import	s a	

Severities toolbar

- ISO 10816: Opens the ISO 10816 machine vibration severity chart (velocity units)
- Envelope: Opens the acceleration enveloping machine vibration severity chart (acceleration units)

Extras toolbar

- Print Machine Codes: Opens the QR Code generation window to create and print QR Code labels
- 3D Model Editor: Opens the 3D ODS Control Panel for editing or importing 3D ODS models
- Bearings Info: Opens the bearing database
- Gear Frequency: Opens the gear frequency calculator
- Advance Tendency: Opens the Dashboard tab to show an overview of the overall machine's health with severity indicators.

Exports and Imports Tool

- Exports: Allows to convert and save any currently opened signal into any of the file extensions UFF58, ASCII y CSV.
- Imports: Allows to transfer any file extensions UFF58, ASCII y CSV into DigivibeMX.

Configuration Menu (All DigivibeMX Models)

D 🞽 🖪	Ŧ				Digivib	eMX M3	30 - 11.32				
	Start	Data Base	Analyze	Functions I	Envelope Alarms	ЗD	Phantom	Tools	Configuration	Help	
C	BE	FV	Ţ	¥	WISER VIESE						
Preferences	Change Languag		Select Device	USB Connection	Connect to WiserVibe						
Settir	ngs	4		Device							\$

Settings toolbar

- **Preferences:** Configures DigivibeMX[®] software and hardware for balancing and/or data collection
- Change Language: Changes the language of DigivibeMX interface.

Device toolbar

• Calibration: Calibrates the software using the calibration device and 2/4 Channel interface

Wifi Connection

- Select Device: Used to verify and select a connected interface
- USB Connection: Toggles Digivibe input sources between USB-connection devices and WiFi-connection devices (WiSer3x)

¥
USB Connection

Help Menu (All DigivibeMX Models)



Digivibe Update software toolbar

- Check for Updates: Checks the Erbessd Instruments server for updated software versions. DigivibeMX v11
 updates can be performed immediately or downloaded for later installation.
- Release Notes: Automatically downloads the latest release notes document where the recent updates will be detailed.

Monitoring Service Update software toolbar

- Check for Updates: Checks the Erbessd Instruments server for updated El Monitoring software versions. Help toolbar
 - Help Index: Opens a link to the Erbessd Instruments user manual.
 - Online Help: Opens a link to download TeamViewer QuickSupport for online remote support
 - Video Tutorials: Redirects to the YouTube page where you can find video tutorials for Erbessd Instruments devices.

www toolbar

- Erbessd Instruments: Opens a web browser linked to the Erbessd Instruments website
- El Analytic: Opens a web browser linked to the El-Analytic homepage

Activation toolbar

- Activation: Opens the software activation window
- About: Displays software version and copyright information

View Options toolbar

 View Options: Changes the screen appearance and coloring of DigivibeMX software for easier viewing in high light, low light or other conditions which might otherwise make viewing difficult.

Routes Module (M20, M30)

The Routes module is activated by selecting New Route, Start Route, Quick Route or Code Route on the Start menu


D 🧉 🖭									DigivibeMX M	30 - 11,3	6							38	_ 0	1 ×
(E)4 () 9	Start	Data Base	Analyze Funct	ions Ervel	lope Alarn	ns 30	Phantor	n Tools	Configuration	неір										
	1		-		đ.	9	麗		NO	1		-	ODS	ODS	Ê		A	0		
New Analysis	Oper	Multiple File Selection	New Balance	New Route	Start Route	Quick Route	Code Route	New Schedule	Route Compliance	Login	Logout	New Machine	ODS	Real Time ODS	New report	Trends	Help Index		Video Tutorials	
	Measure		Balancing				Routes		3	El-Ant	lytics		Machine	a a	Report	ng .		Help		0

Selecting New Route launches the window to create a new vibration data collection route from machines in the current database, before proceeding to the Routes module.

Selecting Start Route launches the Routes module immediately. Load an existing vibration data collection route to begin collecting data.

Selecting Code Route launches the QR Code scanning window. Scanning a machine QR code opens the scanned machine in the Routes module for immediate data collection.

Selecting Quick Route will display a notification and checkboxes will appear in the machine tree. Here, we can select those machines that we need for a fast route with predefined capture values. Clicking Ok will open the route wizard you know in "Start Route"

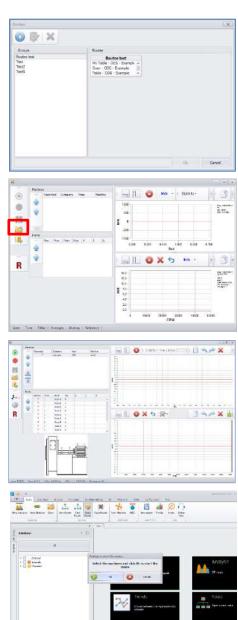


Balancing Module (M10, M30)

The Balancing module in versions M10 and M30 is opened by selecting New Balance on the Start menu, then selecting whether to perform:

- Soft Bearing Suspension (SBS) balancing on a soft bearing suspension balancing stand, or...
- Influence Coefficients balancing on an assembled machine or hard bearing stand

									DigivibeMX M3	50 - 11.5	0							1.125	- 0
Start	Dat	a Base Ar	nalyze Functi	ions Ervel	lope Alarm	in 30	Phanton	n Tools	Configuration	Help									
	-		#		-	9	342		10	۶	0	-	ODS	ODS	Ê		A	0	***
w Analysis Op		tultiple File Selection	New Balance	New Route		Quick Route	Code Route	New Schedule	Route Compliance	Login	Logout	New Machine	ODS	Real Time ODS	New report	Trends		Remote Support	Video Tutorials

The Balancing module for Influence Coefficients launches in a separate window as follows:

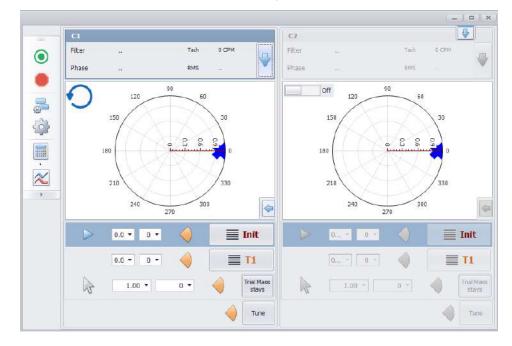

- **2 Planes Auto** (only applies to the I-600 Sequential interface. See Appendix 1 for details): Allows for automatic sequential recording of both planes, or independent recording of each plane
- **Record**: Starts vibration and phase data collection
- **Stop**: Stops vibration and phase data collection
- Polar Graphic: Shows or hides the polar graphs in a rolling session
- **Filter**: Defines a rotational speed frequency range to improve phase measurement accuracy
- Balancing Calculator: Assists with adjusting to conditions that could affect balancing accuracy
- Tacho: Displays the indicated rotor speed signal from the Tachometer


Using DigivibeMX® Software

DigivibeMX[®] is a powerful and versatile Condition Monitoring software. It empowers users with industry-leading vibration analysis and dynamic balancing capabilities. New tasks open in one of two ways:

- In a tabbed window of the Analysis and Work Area, which allows switching between several tasks in progress.
 Individual tabs can be closed when tasks are complete.
- As a separate module of the software, which can be closed when the task is complete (Route data collection and Balancing functions)

Start Tab

Features large quick-launch tiles to make selecting and launching key functions easier in a tablet computer environment. The pane can be scrolled horizontally by holding the mouse left-click button and dragging the screen, by rolling the mouse scroll wheel, or with a finger slide on touchscreens. Tiles may be rearranged as desired.

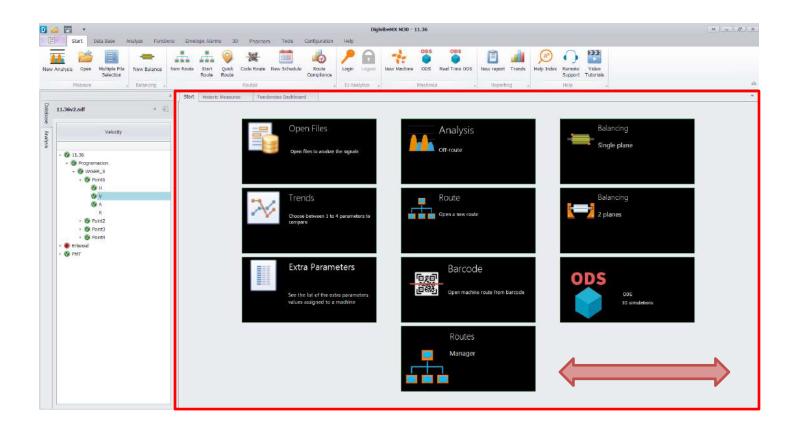

Start screen tiles

Open Files tile (M20, M30, Phantom) - Opens the Historic Measures tab, which allows selection of vibration data recordings from the database for analysis.

	Open Files	Start	Historic Measure		🖳 🖻 🍋 '	
-	Open files to analize the signals		column header her rity (Velocity)	e to group by that colum	Axis	mm/s
		×	Ø	Point1	Н	0.4604
			0	Point1	Н	0.7878
			0	Point1	н	0.7969

Tendency tile (M20, M30, Phantom) - Opens the Dashboard Tendency tab, which allows trending of vibration data from the database in real values (acceleration, velocity, displacement, acceleration enveloping) or severity (score).






NEW!!! Extra Parameters tile (M30, Phantom) – Opens the Historic Extra Parameter, wich allow to see the historical measures like RPM, Current, Temperature or GPIO.


	Start Historic Extre Peranters 🗶			
 Extra Parameters	· 🗮 🖻 🛉		Ol-mer Di-ebr.	
	Amp Phase 3 Amp Phase 1 Au	spiPhase 3 Prissure Temperature		
See the list of the extra parameters	Antone in a chine sui prove a	run diteratione Value	Parametor	Date
	Compressi	0.125	Andersce	25/02/2020 08:58:25 e. m.
values assigned to a machine	Compress	0.125	Anderade	36/03/2020 08:43:18 a. m.
	Compressi	0.06	Amperade	25/03/2020 08/38/01 a. m.
	Compress	0.125	Anderson	26403/2020 08: 32:09 n.m.
	Compressi	0.125	Antoerage	25/03/2020 08:20:11 a.m.
	Compressr	0.125	Anperage	26/03/2020 07:33:14 e.m.
	Compressr	0.125	Amperaçe	26/03/2020 07:28:00 a.m.
	Compressi	0.125	Amperage	26/03/2020 07:23:19 b. m.
	Compress	0.06	Amperage	25/03/2020 07:12:49 n.m.
	Compresor	0.125	Anperage	26/03/2020 07:02:31 a.m.
	Compressr	0.06	Amperage	25/03/2020 06:59:06 e.m.
	Compressor	0.125	Anperage	36/03/2020 06:46:27 a.m.
	Compresar	0.06	Amperage	36/03/2020 06:26:25 a.m.
	Compressr	0.125	Anperage	26/03/2020 06:22:51 s.m.
	Compresor	0.06	Anperage	26/03/2020 06:17:12 a. m.
	Compresor	0.06	Anperage	25/03/2020 06:13:40 e.m.
	Compressor	0.125	Amperage	26/03/2020 06:09:58 a.m.
	Compresar	0.125	Anjperage	36/03/2020 06:01:19 a. m.
	Compresor	0.125	Anperage	25/03/2020 05:58:00 s.m.
	Connesa	0.125	Americe	2603/2020 05:51:24 a.m.

Analysis tile (M20, M30) - Opens the Analysis tab for collecting and analyzing off-route data.

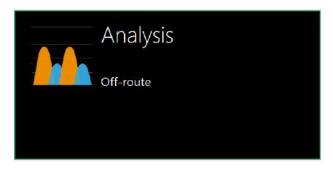




Route (Open) tile (M20, M30) - Opens the Route module for loading and collecting an existing route.

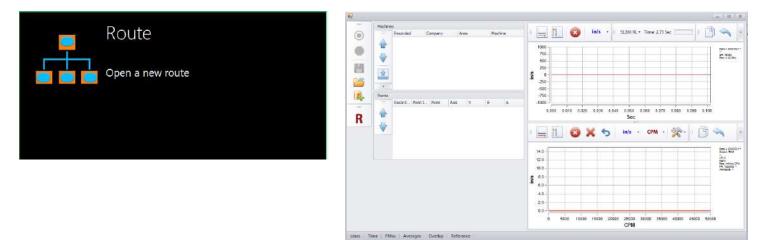

Routes Manager tile (M20, M30) - Opens the Routes window for creating new vibration data collection routes from machines in the current database.

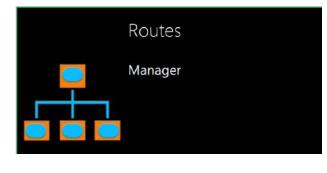

11528					
🕹 🚱 🗙					
Groups	Routes				
		Ok	Cancel		

\$1200 AL+ Tero: 279 So

× 🛓

X


100 1.0

Barcode tile (M20, M30) - Opens the Barcode reader. A scanned machine then opens in the Route module for vibration data collection.





ODS tile (M20, M30) – Selecting a 3D-model assigned machine from the database, then selecting the ODS tile opens the machine in the ODS control panel.



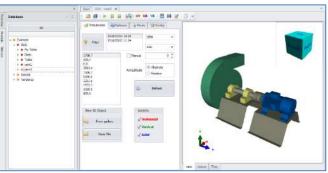



Balancing single plane tile (M10, M30) – Opens the Balancing module to perform a single-plane balance.

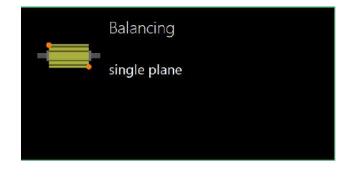

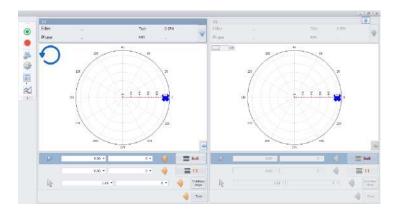


Balancing 2 planes tile (M10, M30) – Opens the Balancing module to perform a 2-plane balance.

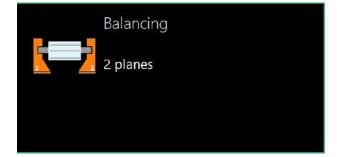

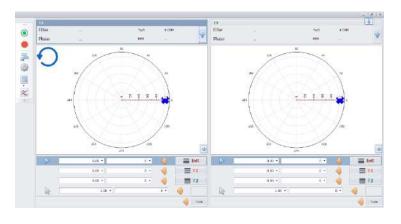

Left-Hand Panel and Shortcut Tabs

The left-hand panel provides information related to the current database or tasks in progress. It also features two shortcut tabs, allowing quick transition between viewing the Database and Analysis tasks in progress.

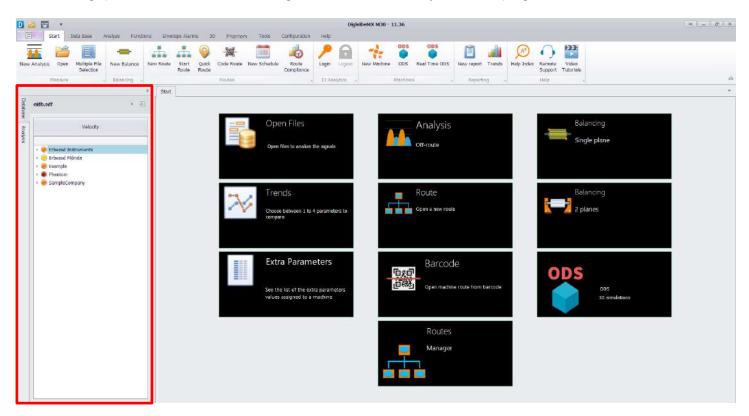

Database Tab

The Database Tab provides navigation within the currently-opened database - a file and folder system where all collected data is stored. The DigivibeMX® database system is compatible with SQL, MySQL, SQLCe file formats. For specific Data Base Menu features and functions, please refer to the "Using the Data Base Menu" section on Pg 46.


Database folders and files are displayed in a standard tree format. Database hierarchy is as follows:


- **Highest Level**: Company Name, Customer Name or Plant Location (for service providers or other users collecting data in multiple plant locations)
- Second Level: Production or Process Area
- Machine Level: Machine ID
- Measurement Point: Bearing or measurement location
- **Measurement Axis**: H (horizontal), V (vertical), A (axial) or R (reference channel for ODS rendering)

If Machine Alarms are used, each level of the database will display the highest severity alarm for any collected data it contains.

NOTE: Right clicking on items in the Database opens a context menu. Active options available from the menu will depend upon the level of the item selected. Configure and Duplicate options are only available at the Machine Level.

The button unpins the left-hand panel from its default location. The panel can be moved to the right-hand side of the Digivibe screen, stacked above, below or hidden. Click and hold the unpinned panel and drag toward the center of the screen. An orientation diagram appears. Drag the panel to the new desired position on the diagram.

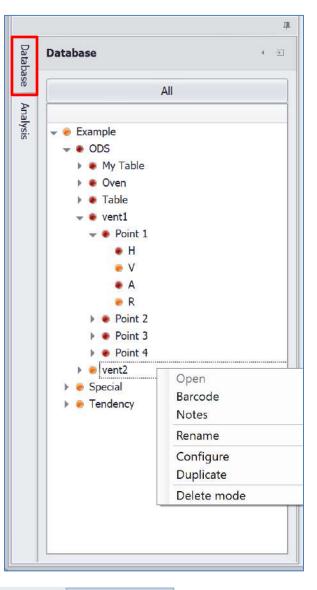

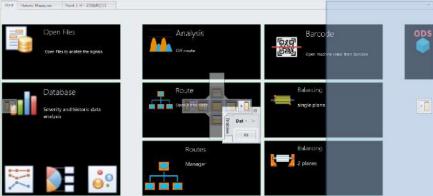

Analysis Tab (M20, M30)

The Analysis tab opens the telemetry panel for Vibration Analysis and Off-Route data collection. Up to 4 channels of data may be simultaneously displayed and compared.

The **Analysis** panel has 2 information tabs: Values and Analysis.

The Values information tab displays the following values of collected vibration data for each channel.

- RMS: Root Mean Square of overall vibration.
- Max: Maximum amplitude FFT peak.

- Max Freq: Frequency of highest FFT vibration peak.

- **Peak to Peak:** Amplitude of the waveform from its highest to lowest peak.

- **Crest Factor:** Compares how close the waveform is to a pure sinusoidal waveform value of 1.414.

The button hides the displayed information

The ^e button restores the hidden information

Dat	Analysis	4	ب ج
Database	Values Analys	is	
Analysis	C1 RMS:	0.0728	٦
/sis	Max:	0.0399	
	Max Frec:	7186.7	
	Peak to Peak:	0.4284	
	Crest Factor:	2.90	
	C2 RMS:	0.8128	
	Max:	0.8524	
	Max Frec:	1796.7	
	Peak to Peak:	2.8083	
	Crest Factor:	1.78	
	C3 RMS:	0.1243	
	Max:	0.0877	
	Max Frec:	5390.0	
	Peak to Peak:	0.6247	
	Crest Factor:	2.40	
	C4 RMS:	0.0640	
	Max:	0.0329	
	Max Frec:	1796.7	
	Peak to Peak:	0.4496	
	Crest Factor:	3.17	

 
Analysis Tab continued (M20, M30)

The Analysis information tab features several key functions for quickly analyzing common concerns.

– Reference Channel button: Used to select the channel to which analysis functions will be applied.

- **Frequency and Arrow buttons:** Used to select or specify the desired fundamental frequency to compare relative phase or calculate bearing and gear fault frequencies.

- **Markers:** Places markers on the FFT spectrum for the Max, Max 5 or Max 10 frequencies, as desired.



- **Phase:** Shows the relative phase comparison for all channels open for analysis (up to 4).




- **Bearings & Gearboxes:** Displays bearing and gearbox fault frequencies assigned during machine building in the database. If none are assigned, they may be added using the Bearing and Gearboxes tools.



- **Values Field:** Displays values for the specified Markers, Phase, or Bearing & Gearbox calculations.
- Clear list: Clears data from the Values Field
- **Delete last:** Deletes the last value calculated from the Values Field.
- **Draw:** Places corresponding markers on the FFT spectrum for values displayed in the Values Field

	ù
Datab	Analysis + =
ase	Values Analysis
Database Analysis	Channel 1
	Frequency
	Markers
	○ Phase
	O Bearings & Gearbox
	🚖 Max 🚖 Max 5
	🚖 Max 10
	Drag a column header here to group the nat colum
	Ch Amp Freq Extra
	Clear Delete
	list Alast

Analysis and Work Area

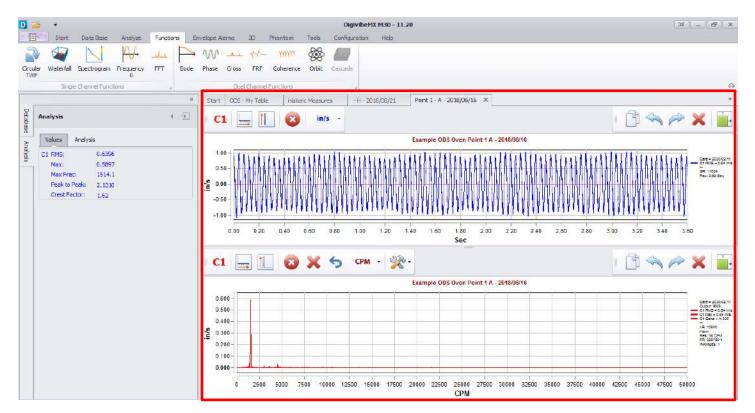


The Start screen, new tasks and functions open as tabbed windows in the Analysis and Work Area.

This format allows users to easily switch between various tasks in progress. When a certain task or function is no longer required, its tab may simply be closed. The only exceptions are Dynamic Balancing and Route Data Collection functions, which open separately in their own independent software modules.

Historic Measures window (M20, M30, Phantom)

 On the Start tab, select the Open Files tile to open the Historic Measures window.



Selecting the Plant level in the data tree displays the most severe data collection for each area in the Plant.

1 🖬 🖪				23-Oct - 23-Nov	<	
					1	
column heador hare to						
rity	Area	MAX in/s	MAX g	MAX gE	C_File	
٠	SampleArea	4.843031	0.858897	0.300988	No File	
	arity		arity Area MAX in/s	arity Area MAX in/s MAX g	arity Area MAX in/s MAX g MAX gE	arity Area MAX in/s MAX g MAX gE C_File

Selecting the Area level in the data tree displays the most severe data collection for each for each machine in that Area.

\$	Start Historic Measu	res x			
()) 🗟 🗙 🔜	· #. [*]} *	23-0	Oct - 23-Nov
Velocity	Drag a column header he	re to group by thet column			
	Severity	Machine	MAX in/s	MAX g	MAX gE
SampleCompany	i	Machinel	0.01015484	-	0.00375345
- 🥏 SampleArea		machine2	0.7649606	124	0.101477
🕨 🥮 Machine1	8	Machine3	0.02637795	-	-1
Machine11	S	Machine4	0.03811949	-	0.0947355

Selecting the Machine level in the data tree displays the most recent collections at each point and axis for that machine. Select View File to open a data collection's Time Waveform and FFT in the Analyze window.

	# Start	Historic Measure	s x							
	• 1		,⊟ 🗙	📆 🖻 🖣			23-Oct - 23	Nov		
Velocity	Drag a co	Humn neader her							10	
	Sever	ity Point	t Axis	in/s	g	gE	Extra	Date	View File	
SampleCompany	•	🔮 Point	1 Н	0.007	0,0267	0.017	Type: Scheduled	2020-11-23 11:	Open	1 File
- 🧒 SampleArea		C Point	1 V	0.005	0.0183	0.013	Type: Scheduled	2020-11-23 11:	Open	1 File
🕖 🥮 Machine1		🧐 Point	1 A	0.007	0.0217	0.011	Type: Scheduled	2020-11-23 11:	Open	1 File
 Machine11 		O Point	2 H	0.017	0.0455	0.022	Type: Scheduled	2020-11-23 11:	Open	File
🕨 🥮 machine2		C Point	2 V	0.007	0.0243	0.013	Type: Scheduled	2020-11-23 11:	Open	i File
		O Point	2 A	0.011	0.0293	0.017	Type: Scheduled	2020-11-23 11:	Open	i File
		Point	:3 H	0.365	0.0710	0.001	Type: Route	2020-09-11 11:	Open	1 File
* h		Point	:3 V	4.843	0.8589	0.006	Type: Route	2020-09-11 11:	Open	1 File
		Point	:3 A	0.263	0.0944	0.002	Type: Route	2020-09-11 11:	Open	1 File
Point 3		Point	:4 Н	0.314	0.1144	0.044	Type: Route	2020-09-11 11:	Open	i File
SampleArea Machine1 Machine11 machine2 Machine3 Machine5 Machine5 Point 1 Service 2		📀 Point	4 V	3.530	0.6290	0.020	Type: Route	2020-09-11 11:	Open	1 File
🕨 🥮 Machine6		📀 Point	4 A	0.186	0.0678	0.019	Type: Route	2020-09-11 11:	Open	1 File

Historic Measures window continued (M20, M30, Phantom)

Selecting the Point level in the data tree displays the most recent collections at each axis for that point. Select View File to open a data collection's Time Waveform and FFT in the Analyze window.

	S	tart Historic	: Measures 🗙								*
· 4 원				3 🗙 🗉	1 🖹 🕯			23-Oct - 23	Nov		
Velocity	86	ag a column ne	ader here to gro	ip by that column						1	1
		Severity	Point	Axis	In/s	g	gE	Extra	Date	View File	
SampleCompany		Ø	Point 1	н	0.007	0,0267	0.017	Type: Scheduled	2020-11-23 11:	Oper	n File
🥏 SampleArea		Ø	Point 1	v	0.005	0.0183	0.013	Type: Scheduled	2020-11-23 11:	Ope	n File
🕨 🥮 Machine1		0	Point 1	A	0.007	0.0217	0.011	Type: Scheduled	2020-11-23 11:	Oper	n File
Machine11		0	Point 2	Н	0.017	0.0455	0.022	Type: Scheduled	2020-11-23 11:	Oper	n File
🕨 💮 machine2			Point 2	v	0.007	0.0243	0.013	Type: Scheduled	2020-11-23 11:	Oper	n File
Machine3		0	Point 2	A	0.011	0.0293	0.017	Type: Scheduled	2020-11-23 11:	Oper	n File
		٠	Point 3	н	0.365	0.0710	0.001	Type: Route	2020-09-11 11:	Ope	n File

Selecting the Axis level in the data tree displays all historical collections at that axis. Select View File to open a data collection's Time Waveform and FFT in the Analyze window.

	0	Sta	art Historic	Measures 🗙								
	4 E	W			3 🗙 🗉	💺 🖻 🍕		-	23-0ct - 2	23-Nov	4	
Velocity		Drag	g a column he	ador here to gro	ip by that column							
		S	Severity	Point	Axis	in/s	9	gE	Extra	Date	View File	
SampleCompany		×.	0	Point 1	Н	0.012	0.0267	0.017	Type: Scheduled	2020-11-23 10	Open File	ŝ.
- 😸 SampleArea			0	Foint 1	Н	0.011	0.0269	0.017	Type: Scheduled	2020-11-23 08	Open File	ŝ.
🕨 🥮 Machine1			0	Point 1	Н	0.014	0.0280	0.017	Type: Scheduled	2020-11-23 06	Open File	e .
Machine11			Ø	Point 1	н	0.011	0.0262	0.017	Type: Scheduled	2020-11-23 04	Open File	÷
machine2			0	Point 1	н	0.009	0.0266	0.017	Type: Scheduled	2020-11-23 02	Open File	
 Machine3 			0	Point 1	н	0.014	0.0272	0.017	Type: Scheduled	2020-11-23 00	Open File	a
• 🥑 Machine4 - 💿 Machine5			0	Point 1	н	0.011	0.0277	0.017	Type: Scheduled	2020-11-22 22	Open File	e
- Ø Point 1			0	Point 1	н	0.014	0.0282	0.017	Type: Scheduled	2020-11-22 20	Open File	2
© H			C.	Point 1	н	0.015	0.0278	0.017	Type: Scheduled	2020-11-22 18	Open File	a
₫ v			ø	Point 1	н	0.012	0.0267	0.017	Type: Scheduled	2020-11-22 16	Open File	2
🧭 A			0	Foint 1	н	0.014	0.0269	0.017	Type: Scheduled	2020-11-22 14	Open File	3

To view the file path where the current database is located, hover the cursor over the left-hand Database tab.

		ġ.	Start	Historia	: Measures	x
Database	26112019135552_test_demo_erbessd	4				•
X	지 가지는 가는 것은 것은 것은 것이 없다.	11	- Contraction			
se	rver=ErbessdCloudService;database=261120 Velocity	19135552_t			ader here i	te group
se		19135552_t	Torag a			to group
Analysis		19135552_t	Torag a	column ne	ader here I	

Historic Measures window continued (M20, M30, Phantom)

To open multiple readings in a cascade plot, highlight the desired readings (drag down the list or Ctrl+click to select desired rows) and select the Cascade icon. The Copy button copies data from highlighted cells to paste into Excel, Word, etc. The Delete button deletes highlighted cells from the database.

Start Historic M	easures ×								3
		🗙 🏬 🖪		-			23-Oct - 23-Nov		
ag a column head	er here to group by t	iat column							/
Severity	Point	Axis	in/s	g	gE	Extra	Date	View File	
0	Point 1	н	0.012	0.0267	0.017	Type: Scheduled	2020-11-23 10:31:24	Open File	
9	Point 1	н	0.011	0.0269	0.017	Type: Scheduled	2020-11-23 08:31:16	Open File	
0	Point 1	н	0.014	0.0280	0.017	Type: Scheduled	2020-11-23 06:31:29	Open File	
۲	Point 1	н	0.011	0.0262	0.017	Type: Scheduled	2020-11-23 04:31:17	Open File	
3	Point 1	н	0.009	0.0266	0.017	Type: Scheduled	2020-11-23 02:31:23	Open File	
0	Point 1	н	0.014	0.0272	0.017	Type: Scheduled	2020-11-23 00:31:17	Open File	
3	Point 1	н	0.011	0.0277	0.017	Type: Scheduled	2020-11-22 22:31:19	Open File	
0	Point 1	н	0.014	0.0282	0.017	Type: Scheduled	2020-11-22 20:31:25	Open File	
0	Point 1	н	0.015	0.0278	0.017	Type: Scheduled	2020-11-22 18:31:19	Open File	


Mode: Select between rendering the TWF, FFT or you can choose Trend option to see the trends for the chosen points..

Settings:

- Increase or decrease zoom on the X or Y axis.
- Switch between 2D or 3D view.
- Toggle point name labels on/off
- Toggle severity indication on/off
- Toggle filter on/off
- Select amplitude units to display.

The check boxes can be used to display or hide selected recordings.

Use the Copy button to copy the cascade plot to the computer clipboard and paste into a Word document, email, etc.

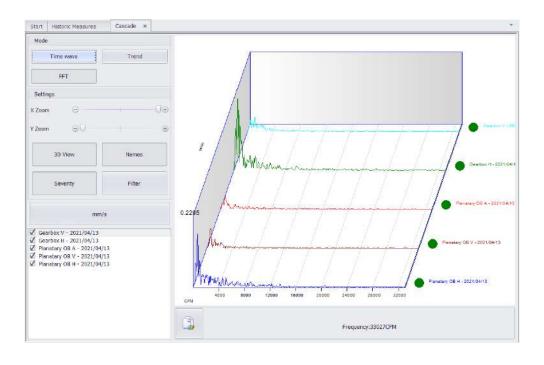

Internal RMS (M20, M30, Phantom)


	= 🗙 [- 1 🔐 🖂 -	-			01-10-2020 - 05-03	-2021		
ng a column header her									1	
Severity (Velocity)	Point	Axis	mm/s	g	gE	Extra	Date	View File		
٢	Punto 1	н	0.9494	0.0679	0.0311	Type:Scheduled	2020-12-16 09:24:20	Open File		
9	Punto 1	н	0.7140	0.0675	0.0315	Type:Scheduled	2020-12-15 18:24:23	Open File		
9	Punto 1	н	0.6069	0.0687	0.0310	Type:Scheduled	2020-12-15 17:24:23	Open File		
3	Punto 1	н	0.8500	0.0689	0.0319	Type:Scheduled	2020-12-15 16:20:54	Open File		
0	Punto 1	н	0.6468	0.0667	0.0311	Type:Scheduled	2020-12-15 12:24:25	Open File		
0	Punto 1	н	0.7499	0.0666	0.0311	Type:Scheduled	2020-12-15 11:24:24	Open File		
۲	Punto 1	н	0.7732	0.0692	0.0312	Type:Scheduled	2020-12-15 10:20:54	Open File		
0	Punto 1	н	0.6797	0.0673	0.0312	Type:Scheduled	2020-12-14 15:24:29	Open File		
0	Punto 1	L	0.8432	0.0588	0.0322	Type:Scheduled	2020-12-14 14:24:28	Open File		

This new DigivibeMX 11 feature allows you to visualize the RMS information of your signals. To access to this data, you have to locate yourself in the tree within an axis and then press the "Show Internal RMS" button. At the end of the list all of the RMS information will appear.

mliphantom.sdf	• 1	💌 🖌 🎁	-= × !						01-10-2020 - 05-03-	
Velocity	379	e column headar hae	to group by that colum							
	S	eventy (Velocity)	Point	Adds	mm/s	g	gE	Extra	Date	View File
+ 🤗 Programation		0	Punto 1	н	0.9494	0.0679	0.0311	Type:Scheduled	2020-12-16 09:24:20	Open File
🔸 📻 Ofiona		8	Punto 1	н	0.7140	0.0675	0.0315	Type:Scheduled	2020-12-15 18:24:23	Open File
- 🦲 Taller		0	Punto 1	н	0.6069	0.0687	0.0310	Type:Scheduled	2020-12-15 17:24:23	Open File
- 🥮 Fresadora		0	Punto 1	н	0.8600	0.0689	0.0319	Type:Scheduled	2020-12-15 16:20:54	Open File
+ 🚱 Punto 1		9	Punto 1	н	0.6060		-10 C	Type:Internal RMS	2020-12-15 12:38:17	No File
<u>е н</u>		9	Punto 1	H	0.6468	0.9667	0.0311	Type:Scheduled	2020-12-15 12:24:25	Open File
90 V 19 A		0	Punto I	н	1.0100	1	±.	Type:Internal RMS	2020-12-15 11:39:34	No File
8		3	Punto 1	н	0.7499	0.0666	0.0311	Type:Scheduled	2020-12-15 11:24:24	Open File
+ 🦲 Punto 2		0	Punto 1	н	0.5300	2	2000	Type:Internal RMS	2020-12-15 10:38:17	No File
Punto 3		9	Punto 1	н	0.7732	0.0692	0.0312	Type:Scheduled	2020-12-15 10:20:54	Open File
 De Punto 4 			Punto 1	H	1.5100	+	*2	Type:Internal RMS	2020-12-14 15:39:45	No File
 Ø Punto 5 		8	Punto 1	н	0.6797	0.0673	0.0312	Type:Scheduled	2020-12-14 15:24:29	Open File

This feature it's only available from DigivibeMX 11.32 and El Monitoring Service 1.24 and above.


The RMS information is also graphed in the Tendency window, it's important to click on the axis and then press the "Show Internal RMS" button and the information will be displayed.

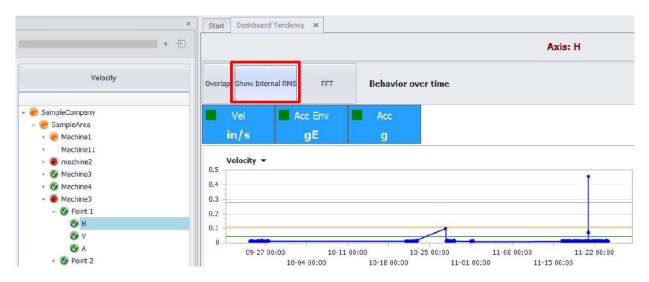

Octave Bands (M20, M30, Phantom)

M 🛯 🛉		🖳 🖻 🍋		01-10-2020 - 05-03	-2021				
a column beader her	e to group by that colum	10.		2}				/	1
everity (Velocity)	Point	Axis	mm/s	g	gE	Extra	Date	View File	1
0	Punto 1	н	0.9494	0.0679	0.0311	Type:Scheduled	2020-12-16 09:24:20	Open File	
0	Punto 1	н	0.7140	0.0675	0.0315	Type:Scheduled	2020-12-15 18:24:23	Open File	
۲	Punto 1	н	0.6069	0.0687	0.0310	Type:Scheduled	2020-12-15 17:24:23	Open File	
9	Punto 1	н	0.8600	0.0689	0.0319	Type:Scheduled	2020-12-15 16:20:54	Open File	
3	Punto 1	н	0.6468	0.0667	0.0311	Type:Scheduled	2020-12-15 12:24:25	Open File	
3	Punto 1	н	0.7499	0.0666	0.0311	Type:Scheduled	2020-12-15 11:24:24	Open File	
0	Punto 1	н	0.7732	0.0692	0.0312	Type:Scheduled	2020-12-15 10:20:54	Open File	
	Punto 1	н	0.6797	0.0673	0.0312	Type:Scheduled	2020-12-14 15:24:29	Open File	
0	Punto 1	н	0.8432	0.0688	0.0322	Type:Scheduled	2020-12-14 14:24:28	Open File	
-	Punto 1	н	0.6854	0.0677	0.0317	Type:Scheduled	2020-12-14 12:21:00	Open File	

This DigivibeMX 11 feature allows you to perform and even greater vibration analysis creating an Octave Bands graph. When pressing on an axis, you can choose any listed signal and press the "Octave Bands" button. To add more signals to the graph, select the files from the list and then press the "Add Measures" button and if you want to delete signals from the graph, press the "Remove Measures" button.

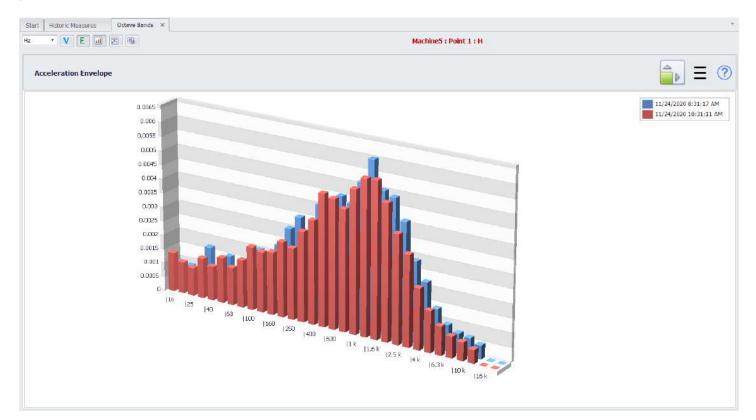


The previous buttons control the information shown on the "Octave Bands" window; with the buttons located on the upper left corner you can choose between showing Velocity or Envelope Acceleration information. You can also change the type of graph plotted; a bar or a line graph.

Open Multiple Files (M20, M30, Phantom)

M 🛯 🗋		🖳 🖻 🗐	- 🖌 🖂	•			01-10-2020 - 05-03	-2021	
eg a column header hei	Virunt handler: here to group by thet column Axis mm/s g gE Extra V(Velocity) Point Axis mm/s g gE Extra V Punto 1 H 0.9494 0.0679 0.0311 Type:Scheduled V Punto 1 H 0.7140 0.0675 0.0315 Type:Scheduled V Punto 1 H 0.6069 0.0687 0.0310 Type:Scheduled V Punto 1 H 0.6468 0.0667 0.0311 Type:Scheduled Punto 1 H 0.6468 0.0667 0.0311 Type:Scheduled Punto 1 H 0.7499 0.0666 0.0311 Type:Scheduled Punto 1 H 0.7732 0.0692 0.0312 Type:Scheduled			1	2				
Severity (Velocity)	Point	Axis	mm/s	9	gE	Extra	Date	View File	
٢	Punto 1	н	0,9494	0.0679	0.0311	Type:Scheduled	2020-12-16 09:24:20	Open File	
0	Punto 1	н	0.7140	0.0675	0.0315	Type:Scheduled	2020-12-15 18:24:23	Open File	e.
۲	Punto 1	н	0.6069	0.0687	0.0310	Type:Scheduled	2020-12-15 17:24:23	Open File	
۲	Punto 1	н	0.8600	0.0689	0.0319	Type:Scheduled	2020-12-15 16:20:54	Open File	1
3	Punto 1	н	0.6468	0.0667	0.0311	Type:Scheduled	2020-12-15 12:24:25	Open File	
9	Punto 1	Ĥ	0.7499	0.0666	0.0311	Type:Scheduled	2020-12-15 11:24:24	Open File	2
۲	Punto 1	н	0.7732	0.0692	0.0312	Type:Scheduled	2020-12-15 10:20:54	Open File	
0	Punto 1	н	0.6797	0.0673	0.0312	Type:Scheduled	2020-12-14 15:24:29	Open File	1
9	Punto 1	u .	0.8432	0.0688	0.0322	Type:Scheduled	2020-12-14 14:24:28	Open File	

This new feature allows you to open more than one file at a time for you to see the FFT and TWF. You can open a maximum of 4 files at a time, however in the future (with new updates) it could be more. You can even combine this feature with the **multiple file selection** to open files on another point or machine.

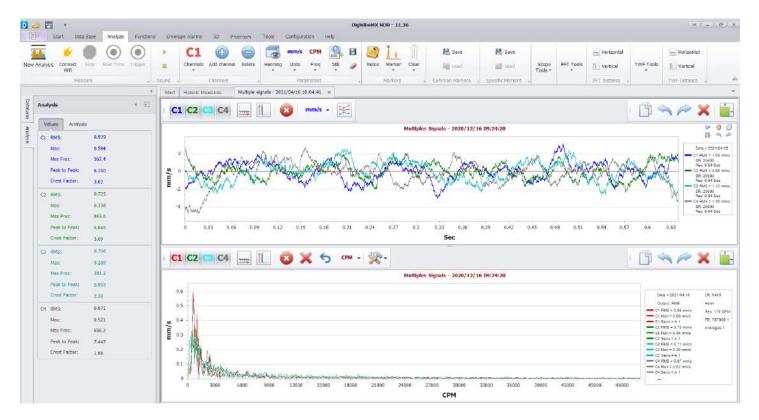

You will see that the name of the graph is now "Multiple Signals", meaning that the files open were used with this tool. Now you can start working with your measurements quicker.

Multiple File Selection (M20, M30, Phantom)

🐸 🛅	Ŧ								DigivibeMX M30	0 - 11.36								390	_ 0	1 ×
E si	tart l	Data Base 🛛 A	utalyze Funct	ions Enve	lope Alarm	s 3D	Phanton	Tools	Configuration	Help										
	1		-		4	0	Day P Day P		S	۶	0	-	ODS	ODS	Ê	d	R	\mathbf{O}	>>>	
w Analysis	Open	Multiple File Selection	New Balance	New Route	Start Route	Quick Route	Code Route	New Schedule	Route Compliance	Login	Logout	New Machine	005	Real Time ODS	New report	Trends	Help Index		Video Tutorials	
1.00	feasure		Balancing .				Routes			EF-An	intice .		Machine:		Report	ne -		Help		

This tool allows you to show more information on the Historic Measures list; even if this information is on another axis. This way you can open files at the same time without having to first open a signal and then adding the channels individually.

		Data Base A	nalyza Functi	ons	Envelope Alarn	15 3C	Phanton		igivibeMX M3 Configuration	Help					
w Analys	is Open	Multiple File Selection	New Balance	New R		Quick Route	Exer Exer Code Route	New Schedule	Route Compliance	Login Log	aut New Machine	ODS CODS CODS CODS CODS CODS CODS CODS C	New report Tren		mote Video Tutorials
	Measure	7	Balancing .				Routes		4	EI-Analytics	4	Machines	. Reporting	a H	ip .
					tart Historic	Measure	s x								
		Velocity		Dr	og a column he Severity (Velo		e to group by Point	that column Axis	m	n/s	g	gE	Extra	Date	View File
- 1	Program	nacion			۲	F	Punto 1	н	0.9	1494	0.0679	0.0311	Type:Scheduled	2020-12-16 09:24:	Open File
	🗌 😸 Oficir				3	F	Punto 1	ν	0.3	1661	0.0283	0.0185	Type:Scheduled	2020-12-16 09:24:	Open File
-	🗆 😑 Talle	er .			8	F	Punto 1	A	0.2	032	0.0247	0.0130	Type:Scheduled	2020-12-16 09:24:	Open File
	• 🗆 🥹														

Clicking the button will change the tree into a multiple selection row, check one of the boxes to show it on the Historic Measures list. Check another box to add more measurements to the list and then use the Ctrl button to select measurements and then the "Open Multiple Files" button to open the files in the same graph as different channels.

F	🤌 🔁 🔹	- 122 N			seen Star	IX M30 - 11.36					x
U.	5tart Data Base Analyze Function	s Envelop	e Alarms	30 Phantom	Tools Configur	ation Help					
-	🦫 🥒 😣 🕅 月		L G	0	P 🔒	0 1					
		tabase Con	Street Proverse	Contraction of the second	Login Logout	Explore Utilities	Database Delete Size Measures				
	Machine	Connects		. Synchronize	EF-Arialytics		Fools .				
	.#	Start	Historic Measi	ires ×							
	milphantom.sdf + 🕤	1 12		h 🖂 🖌	(📖 🖻	é= =	× ·				
		Links and					states -				
	Velocity	Drag a co		ere in group by that							
	Velocity	1.000				mm/s	9	gE	Extra	Date	View File
	Velocity	1.000	ann header h y (Velocity)	ere in group by that	calum			gE 0.0311	Extra Type:Scheduled	Date 2020-12-16 09:24:	View File Open File
		1.000	y (Velocity)	ere to group by that Point	Axis	mm/s	2	- Alight Ann			
	+ 🗌 🍺 Programacion	1.000	ann header h y (Velocity)	ere to group by that Point Punto 1	Axis H	mm/s 0.9494	g 0.0679	0.0311	Type:Scheduled	2020-12-16 09:24:	Open File
	Programacion Oficine	1.000	y (Velocity)	Point Point Punto 1 Punto 1	Axis H V	mm/s 0.9494 0.2661	g 0.0679 0.0283	0.0311	Type:Scheduled Type:Scheduled	2020-12-16 09:24: 2020-12-16 09:24:	Open File Open File
		1.000	y (Velocity)	Point Point Punto 1 Punto 1 Punto 1 Punto 1	Axis H V A	mm/s 0.9494 0.2661 0.2032	g 0.0679 0.0283 0.0247	0.0311 0.0185 0.0130	Type:Scheduled Type:Scheduled Type:Scheduled Type:Scheduled	2020-12-16 09:24: 2020-12-16 09:24: 2020-12-16 09:24:	Open File Open File Open File Open File
	Programacion Softicina Softicin	1.000	y (Velocity) v (Velocity) v	Point Point Punto 1 Punto 1 Punto 1 Punto 1 Punto 2	Axis H V A H	mm/s 0.9494 0.2661 0.2032 1.4497	9 0.0679 0.0283 0.0247 0.0769	0.0311 0.0185 0.0130 0.0410	Type:Scheduled Type:Scheduled Type:Scheduled	2020-12-16 09:24: 2020-12-16 09:24: 2020-12-16 09:24: 2020-12-16 09:24:	Open File Open File Open File Open File Open File


Dashboard Tendency window (M20, M30, Phantom)

On the Start tab, select the Tendency tile to open the Dashboard Tendency window.



The Dashboard Tendency window features four panels of machine data trending information. The trending information displayed is determined by the database level and date range selected. Displayed information in each of the four panels is determined by the alarms set (displacement, velocity, acceleration and acceleration enveloping). Click on the desired values in each panel to instantly re-render the graph according to score (severity), vibration amplitude or hidden from view. Moving the cursor across a graph produces a cursor line for specific point information.

- **Behavior Over Time panel** Displays a trend line of highest values of the day for children under the selected parent level of database, for the date range selected. Left/Right chart scales correspond to values selected.
- **Parameters panel** Chart display of the last recorded measurement for the database level selected. Left/Right chart scales correspond to the nearest value displayed.
- **Time of the Day panel** Displays the highest severity or amplitude collection on the indicated day and time. The blue bars indicate data collections. Higher score or amplitude recordings appear darker. Hovering the cursor over a blue bar displays the corresponding value.

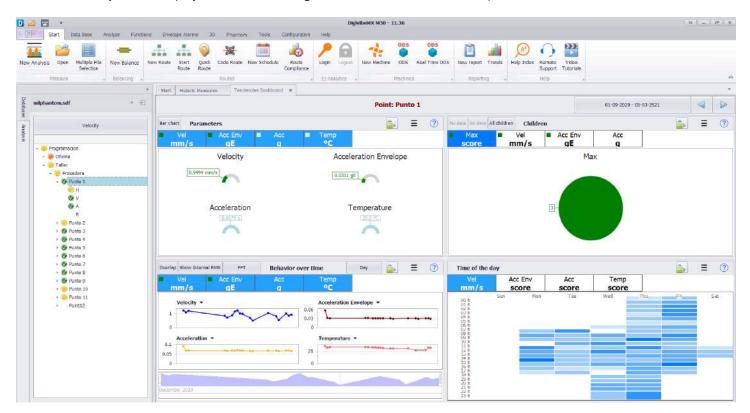

• Children panel – Displays the last recording values for children under the parent database level selected.

The buttons on the upper right corner control the visualization of the information observed in the tab. Information can be obtained from a specific date range or one determined by the software. The second button allows to maximize the information shown on every section of the trends tab and this way have a full screen visualization.

verlap Fi																	
vertap 71					Co	mpany: Sa	mpleComp	any					0	2-5ep - 02-Oct			
	rr 1	ehavior over t	ime											W	eek 🔒	≡	0
Vel score	Act: Env	Acc score	Temp	Атр	Speed score	Phase score	Pressure score										
Velocity	-					Acceleration	Envelope 🔻					Acceleratio	n -				
00			-		3	•			~		3						
00			1		• 2	-					z						_
00					1	-					1	-					
0 08-30-20	09-06-2	0 09-13-20	09-20-20	09-27-2	0	08-30-20	09-06-20	09-13-20	09-20-20	09-27-20	0	08-30-20	09-06-20	09-13-20	09-20-28	09-27-	20
Speed •	100000 10				0.5	Phase 🔻					0.5	psi 🕶					
1.4					0.4						0.4						
1.3					0.3						0.3						
5.2					0.2						0.2						
0	09-06-2	0 09-13-20	09-20-21	1 09-27-2	. 0	08-30-20	09-06-20	09-13-20	09-20-20	09-27-28	0	08-30-20	09-06-20	09-13-20	09-20-20	09-27-	
08-30-20	09-06-2	0 119-13-20	09-20-21	1 09-27-2	20	08-30-20	09-05-20	09-13-20	09-20-20	09-27-26		08-30-20	99-00-20	09-13-20	09-20-20	09-27-	20

For the "Behavior over time" it's possible to choose what information to show and which one to hide only by clicking the parameter that you want to show/hide.

When checking vibration information is possible to visualize the FFT trough the same screen choosing the point to observe inside the tendency graphs.



Using the Data Base Menu (M20, M30, Phantom)

The Database Menu features tools to manage the three database types compatible with DigivibeMX® - SQL, MySQL and SQLCe.

Options on the Database Menu include:


- Create, edit, delete machines and add Notes
- Create, connect to and refresh databases with recent updates
- Login and Logout of an EI-Analytic database (with subscription)
- Explore the data tables and database Utilities

D 🞽 🛅	Ŧ					I	igivibeMX M30	- 11.33						x a _ x
III ∞ S	tart Data B	ase A	nalyze	Functions E	nvelope Ala	rms 3D	Phantom	Tools	Configur	ation I	Help			
-		8				CD	0	1		Q	1			
New machine	Edit machine	Delete machine	Notes	New database	Connect	Refresh	Synchronize	Login	Logout	Explore	Utilities	Database Size	Delete Measures	
	Machine		4	Cor	nection	5.4	Synchronize	a El-An	alytics .		7	rools		4

Machine toolbar (M20, M30, Phantom)

Creating a New Machine in the Database

New : Opens the Configure Machine window for adding new machines to the database. As new machines are created, new Company and Area database locations can also be created, as desired.

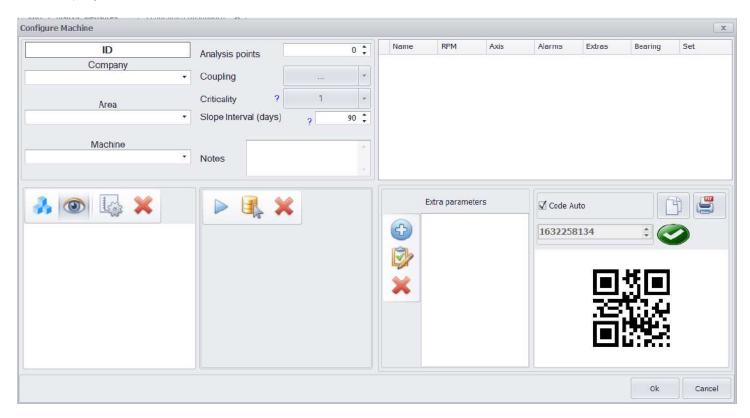

Creating a New Machine in the Database continued

The Configure Machine window has several different panels for specifying machine information.

The first panel is used to specify the New Machine identity and its location. The number of analysis points, coupling type, coefficient, slope interval and additional notes (optional) can also be specified.

ID Company bessd Instruments	Analysis points	Direct	4 🗘	Name Point 1	RPM 1700, 1900	Axis H,V,A,R	Alarms V,AE	Extras	Bearing	Set
	Coupling	Diseast								Set
		Direct		Point 2	1700, 1900	H,V,A,R	V,AE			Set
100 C 100 C	Coefficient ?	1	-	Point 3	1700, 1900	H,V,A,R	V,AE			Set
Area	 Slope Interval (days) ? 	9	0 ‡	Point 4	1700, 1900	H,V,A,R	V,AE			Set
Machine achine005	• Notes		-							1
				 (2) (2)	Extra paramete	rs	√ Code		**2334 : 活画 記録 たな]

- Company: The company who owns the machine
- Area: The production area in which the machine is located
- Machine: The machine name or ID number
- Analysis Point: The number of machine monitoring points where data will be collected and analyzed
- Coupling: The machine coupling or drive configuration (direct, belts, coupled, etc.)
- Coefficient: The machine maintenance priority or criticality for severity trending on a 1-10 scale (1 for critical machines, 10 for nonessential machines)
- Slope Interval: The time period to be considered for machine severity calculations
- Notes: Text field for documenting additional machine information

Creating a New Machine in the Database continued

The second panel is for assigning a 3D ODS model or 2D image for the New Machine. 3D ODS models can be selected from the DigivibeMX® database. External 3D models in .3ds, .xaml, or .obj formats can also imported to DIgivibeMX. (Use **Tools Menu/3D Model Editor** to import files and assign data collection points for ODS animation.) Standard 2D images can also be assigned if ODS capabilities will not be required, for reports, or to be displayed during route data collection.

ID	Analysis points		4 🗘		Name	RPM	Axis	Alarms	Extras	Bearing	Set
Company				•	Point 1	1700, 1900	H,V,A,R	V,AE			Set
rbessd Instruments	, Coupling	Direct			Point 2	1700, 1900	H,V,A,R	V,AE			Set
Area	Coefficient ?	1	-		Point 3	1700, 1900	H,V,A,R	V,AE			Set
lew York	Slope Interval (days) ?	9	0 ‡		Point 4	1700, 1900	H,V,A,R	V,AE			Set
3D ODS					 ⊕ ∅ ★ 	Extra paramete	rs	√ Cod	e Auto 533	442334 :	1
										IC36	LŞ.

3D ODS image controls: Once assigned, the 3D model view can be turned and zoomed in/out within the pane.

- Select and assign a 3D ODS image file
- 💿 : See point locations on the 3D ODS image file
- Image the point locations on the 3D ODS image file
- Remove the selected 3D ODS image file

2D image controls: Once assigned, the 3D model view can be turned and zoomed in/out within the pane.


- Earry the 3D ODS image over as the 2D image file
- Is lect and assign a 2D image file from the local computer
- Remove the selected 2D image file

Creating a New Machine in the Database continued

The third panel displays data collection Points for the machine, component speed, Axis of collections, Alarms and other specific Point characteristics. Extra Parameters are explained on Pg. 53. DigivibeMX v11 creates a unique QR code and machine identifier for every New Machine.


ID	Analysis points	4 🗘	1	Name	RPM	Axis	Alarms	Extras	Bearing	Set
Company			S P	Point 1	1700, 1900	H,V,A,R	V,AE			Set
rbessd Instruments	Coupling	Direct		Point 2	1700, 1900	H,V,A,R	V,AE			Set
Area	Coefficient ?	1 -		Point 3 Point 4	1700, 1900	H,V,A,R	V,AE			Set Set
lew York	 Slope Interval (days) ? 	90 🗘	1	Point 4	1700, 1900	H,V,A,R	V,AE			Set
1 💿 🖾 💥]		G	Extra paramete	rs	Code	e Auto 533	442334	1
(Same]	Ø> ×				5	蠹	

Clicking **Set** on any Point opens the Point Configuration window to configure data collection Point parameters. Detailed parameters enable faster identification of machine faults, enabling a more detailed analysis of collected machine data.

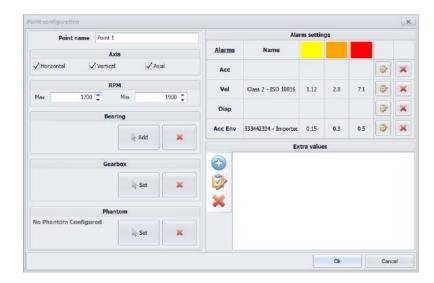

Creating a New Machine in the Database continued

Point Configuration

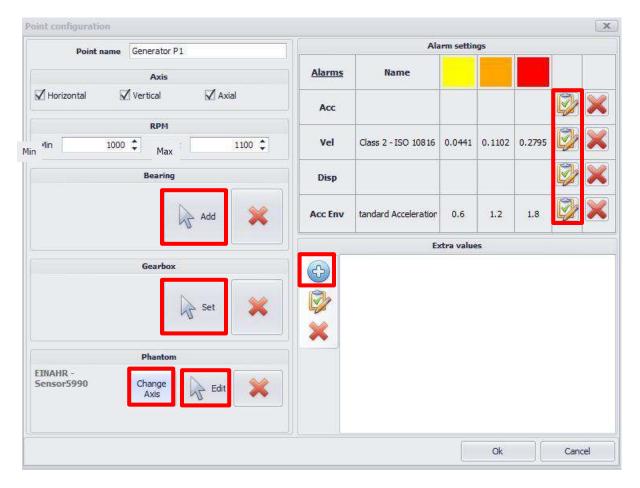

- Axis: Select axis directions to be collected at the Point.
- **RPM**: Enter the Minimum and Maximum expected speed range at the Point
- **Bearing**: Use the **Add** button to launch the Bearing Database and select the bearing installed at the Point. Bearing fault frequency FFT markers will be available on all future data collected at the Point. (See Pg. 50)
- **Gearbox**: Use the **Set** button to launch the Gearbox tool to create and/or select a gearbox at the Point. Gearbox frequency FFT markers will be available on all future data collected at the Point. (See Pg. 51)
- **Phantom**: Use the **Set** button to assign a Phantom sensor to collect data at the Point. (details for setting up and assigning Phantoms are available in the Phantom Setup Guide). Use **Change Axis** button to modify the already set axis.
- Alarm settings: Use the Clipboard buttons to set or edit vibration alarm values, as desired. (See Pg. 52)
- **Extra Values:** Use the **blue plus** button to add a new Extra Value such as speed, Temperature, Current, etc. at the point. Use the Clipboard button to edit any assigned Extra Values. (See Pg. 53)

Creating a New Machine in the Database continued

Assign a Bearing to a Measurement Point

DigivibeMX v11 features a Bearing database containing fault frequencies of over 40,000 common bearings from major manufacturers. Bearings may be permanently assigned to a machine measurement point, or specified during Analysis. The Bearing database features a Search function, a Manual function for adding new bearings and fault frequencies to the database, and a Calculator to calculate bearing fault frequencies using bearing component measurements.

	Search Man	ual Calculator	
63	103	Search	
		Show All	
	Name	Manufacturer	
Þ	6303	NSK	
	6303	SKF	1
	6303E	SKF	
	I-26303	SKF	
	46303	GPZ	
	6303	FAG	
	6303-2RSR	FAG	
	Ok	Cancel	

Enter complete or partial bearing part numbers to Search the database.

Search	Manual	Calculate	or -	
N	lame		_	
	MFR		•	
3	BPFI	0.0000000	\$	
E	SPFO	0.0000000	\$	
	BSF	0.0000000	\$	
	FTF	0.0000000	\$	

Bearings can be manually created using calculated fault frequencies or those provided by the bearing manufacturer.


Search Manual	Calculator		
Name			
MFR	•		
Pd (pitch diameter)	0.0000 🛟		
Bd (ball diameter)	0.0000 🗘		
Number of balls	0 🗘		
β (contact angle)	0.0000 🗘		

The Calculator can be used to calculate fault frequencies using measurements or from data provided by the bearing manufacturer.

Creating a New Machine in the Database continued

Assign a Gearbox to a Measurement Point

 DigivibeMX v11 features a Gearbox tool that may be used to create and edit a comprehensive library of gearboxes. Once created, the gearboxes may be permanently assigned to a machine measurement point, or specified during Analysis.




🀱 Delete a gearbox

Groups panel: Gearboxes may be grouped according to function, manufacturer, production area, etc.

Gearbox panel: Contains all gearboxes created within a selected group.

Groups	Gearbox	
ABC Gearbox	Gearbox0001 Name: Gearbox0001 Manuf: ABC Gearbox Steps: 2	

 Manufacturer: Group to which the
gearbox will be assigned.
Name: The Gearbox name, ID
number, Serial Number, etc.
Description: Text field for
additional description information.



Delete a gearbox step (stage)

Bearings button: The bearings at each step (stage) may be selected from the Bearing Database.

ABC Gearbox	
Gearbox0001	
Generic gearbox for Name Teeth count	Bearings
demonstration purposes.	
Step 1 18 - O Be	earings (0)
Out	
- 36 - OB	earings (0)
In In	
Step 2 - 36 - O Be	earings (0)
Out	
- 72 - ^{O Be}	earings (0)
Out	earin

X

Creating a New Machine in the Database continued

Assign Alarm Settings to a Measurement Point

Vibration alarm limits may be set at each Measurement Point. Alarm limits can be specified for Acceleration, Velocity, DIsplacement and/or Acceleration Enveloping values, as desired. Click the Clipboard button on the corresponding alarm value to establish/edit alarm values.

Parameters: Select the desired parameter from the dropdown.

Available alarm Groups are displayed in the left panel (ISO 10816 is the default group).

Alarm configurations contained in the Group are displayed in the right panel.

Click the Edit button to edit the displayed configuration. Click the Add New button to create a new group or configuration as shown below.

New Yellow, Orange and Red alarm thresholds can be manually entered, or their values adjusted with the up/down arrows.

Specify the Parameter to which the values apply.

Assign the new alarm to a Group and give the configuration a Name.

Click the Available on Gallery button to activate the configuration in the gallery, then click Save.


Parameters	Velocity	-	Include non p	ublic ala
50 10816	Class 1 Class 2 Class 3 Class 4	162References Yellow alarm Orange alarm Red alarm Apply All Points Edit	1.120 ‡ 2.800 ‡ 7.100 ‡	mm/s mm/s

Class 2 Class 3 Class 4 Vellow alarm 0.100 + mm/s Orange alarm 0.2 + mm/s					Indude not	n pu	iblic ala
Parameter Velocity Group ISO 10816 Name New Alarm Available on galery (public Default Save Cancel	150 10816	Class 2 Class 3	Yellow a Orango a Red a Dapply All Points Parameter Group Name	alarm	þ.2 0.400 Velocity 816 arm	сту (1010202-02

Creating a New Machine in the Database continued

Assign Extra Values to a Measurement Point

In addition to vibration data, Extra Values such as Temperature, RPM and Amperage may be documented. Extra Values may be assigned at the Machine level, or at a Measurement Point. Clicking the **blue plus** button to add a new Extra Value opens the Add Parameter window (see below).

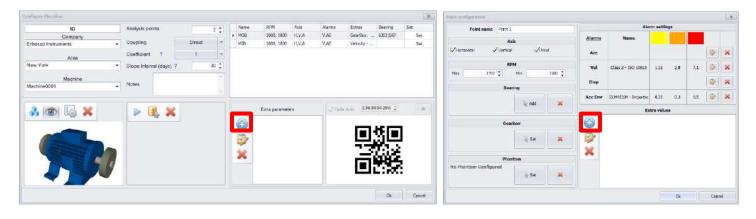

Extra Value parameters are displayed in the left panel (Temperature, Amperage, RPM and GPIO are default parameters).

Existing parameters may be selected, or new parameters may be defined by assigning a new Name. Additional information may be documented in the Description field.

Click the Edit button to assign alarm values, as described on the previous page.

Click the Set Phantom button to assign a Phantom sensor that will collect the parameter.


dd parameter			
Temperature	Info Parameter		
Amperage RPM	Name		
SPIO	Description		-
			~
	Set Alarm		
	Edit	vo alarm set	
	Remove		
Add Unit	Set Phantom		
H-1		Ok	Cancel

Using the Data Base Menu continued (M20, M30, Phantom)

Machine Toolbar continued



Selecting a Machine from the Database, then selecting Edit will open the Configure Machine window for editing.

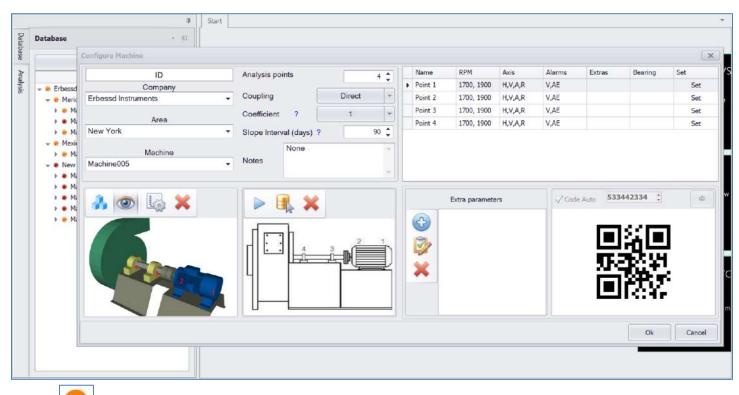

Delete

X

Delete

Selecting Delete allows deleting any items in the Database. Select to items to be deleted then click Delete to remove the desired items from the Database.



Selecting any item in the Database, then selecting Notes opens the Notes window. Notes may be assigned to any item in the Database.

Using the Data Base Menu continued (M20, M30, Phantom)

Connection toolbar



Selecting New allows a new SQL database to be created. SQL database files can be created and saved in any location. It is recommended to keep all database files together in an easily-located common folder.

> · 🛧 📜 · Do	ocuments > Erbessd Instruments 11 > Database	∨ Ū Sear	ch Database	P
Organize • New fold	er)E •	0
S This PC	Name	Date modified	Туре	
🔓 3D Objects	3D Files	9/24/2018 2:55 PM	File folder	
esktop	ODS Data	9/25/2018 3:16 PM	File folder	
Documents	😤 EIDB.sdf	3/19/2019 10:48 AM	SQL Server Compa	ct
Downloads	🖻 EIDB_Example.sdf	5/16/2019 3:41 PM	SQL Server Compa	ct
	🖻 EIDB_ManualExample.sdf	6/3/2019 4:19 PM	SQL Server Compa	ct
🕽 Music	🖻 El-Phantom.sdf	6/1/2019 1:00 PM	SQL Server Compa	ct
E Pictures	🖻 test1.sdf	3/12/2019 12:54 PM	SQL Server Compa	ct
Videos				
💺 Local Disk (C:) 🛛 🗡	<		j.	
File name: EIDE	.sdf			2
Save as type: SQLC				
	nu Mercent.			
Hide Folders			Save Cano	el



If database files are moved between devices or stored remotely, Connect to Database allows mapping *DigivibeMX* to their new location.



Updates the database view to reflect any new data or modifications.

Using the Data Base Menu continued (M20, M30, Phantom)

El-Analytic toolbar



Connects *DigivibeMX* to the EI-Analytic cloud-hosted database service, if activated (subscription service). For more details about the EI-Analytic cloud-hosted database service, please contact an Erbessd Instruments distributor, sales or technical support.

Tools toolbar



Allows manual exploration of the database and data tables.



Database Utilities to:

- Update a legacy database to the current version
- Repair corrupted databases
- Compact databases
- Import updated databases

Using the Analyze and Functions Menus (M20, M30, Phantom)

The Analyze and Functions Menus feature tools for collecting and analyzing machine vibration data.

New off-route analysis (M20, M30)

This type of immediate, off-route analysis with a portable instrument is not associated with any machine in the database. It will not be automatically saved. Off-route analysis is recommended for spot-checking, troubleshooting or other situations when machine vibration data must be displayed, but not necessarily saved to the database. However, off-route data collections can be saved by opening the File Manager and selecting Save. Files can be saved to the database under an existing machine. Files can also be saved outside the database as .anl files and emailed to other DigivibeMX users for review.

There are two different methods for opening a new immediate, off-route data collection and analysis session:

Method 1 – New Analysis on the Start Menu.



Method 2- Analysis tile on the Start tab.



Both methods open the Analyze Menu, launch the Analyze tab and switch the left-hand panel to the Analysis view.

	• Start Data Bas	e An	alyze Ru	nctions f	nvelope Alarm	s 10	Phontom	Digi	Configur	130 - 11.20						[a] _	
iecord 1		upan.	*	*		Delete (ndow Uni	s Freq	50k	Markers *	81 78	8	FFT Tools	Interizontal	TWF Tools	크 Horizontal	
	Measure	4	licond "	¢.	Channels	8/08/21	Fornt 1 - A	2018/05/1		V - 2018/05/		Bpecific Ma	-H - 2018/06/15	- 4 - 2018	4 66/36 AV	TWF Distance	*
Anal	ysts			(-21			83 m	n/s' -					• Time: 2.73 S		3		1
	ues Analysis	Channe	el 1		1000- 25 500- 25 E				_								- 2025/05 1000 100 Sec

NOTE: When no interface is connected the recording control buttons will be greyed-out, as shown above.

New off-route analysis continued (M20, M30)

Start/Stop Data Collection

The Analysis tab launches with the default recording parameters specified in the Configuration Menu/Preferences. If different resolution lines or recording times are desired, changes can be made prior to recording data. Select the number of data channels to be collected (up to 4) from the Channels dropdown. The Time Waveform and FFT will render in real time as data is collected.

		C1	00	mm/s' CPN	۸ 💽	E.	B			Horizontal
lecord	Stop Real Time Trigger 🧧	Channels	Add channel Delete	Window Units Free	a 50k Markers	14	FFT Tools	U Vertical	TWF Tools	U Vertical
	Measure . Sound .		ihannele "	Parameters	-	Common Ma 4	Specific Ma	FFT Distance		TWF Distance
		4	- H - 2018/08/21	Point 1 - A - 2018/06/	16 - V - 2018/05	15 - V - 2018	8/06/16 - H - 2018/05/	15 - 4 - 2018/0	06/16 An	ndysis 🛪 👻 🗧
	Inalysis	4 문		🔯 mm/s -			51200 RL • Time: 2.7	Sec		N 🊧 🗙 🛙

Data collection is started with



and will end automatically, based on the specified Resolution Lines.

Data collection can be stopped manually with

To monitor a live stream of continuous data, use



eal Time to begin, then press Stop when finished.

NOTE: Real Time data is not saved while monitoring. Only the information visible in the TWF and FFT can be saved, when the collection is stopped. To record a long TWF, set the recording time to the required duration and press Record.

The function is used in conjunction with the Trigger value specified in Configuration/Preferences/Channels tab


NOTE: Press the Trigger button to prepare Digivibe for a Trigger recording. The actual recording will not begin until the specified Trigger vibration value is reached.

Viewing Vibration Data (M20, M30, Phantom)

To review collected data, select the Open Files tile on the Start tab. This opens the Historic Measures tab. Select the desired level of data in the database. Select View File to open the recording for analysis.


 Open Files	Data	a Database 4 [4]	Shert Historic	teasures ×	P				20 -ere -	- 30-feb		•
-	base And	Al		Print	CONT PALL	injs	10	oF	Extra	Date	VenFie	
Open files to analize the signals	8	-	i e	LADO POLEA	H	0.018	0.0723	0.021	Type: Scheduled		View F	Be
		- 😕 Erbessel Mérida	0	LADO POLEA.	¥.	0.009	0.9744	0.016	Type: Scheduled	2020-02-20 040	Very S	54
		- 🥑 Mecánica	0	LADO POLEA	A	0.006	0.0250	0.015	Type: Scheduled	2020-02-20 04-0	View F	fie
		AC-Almacan AC-Electronice		LADO LERE	н	0.022	0.0329	0.019	Type: Scheduled	2020-02-20 14.1.	View 8	file .
		AC-DECOVICE AC-PECATICE	0	LADO LIBRE	¥.	0.009	1.0125	0.016	Type: Scheduled	2020-02-20 1.4-3	View f	file
		Contretor	0	LADO LIBRE	A	0.022	0.0690	0.021	Type: Scheduled	2020-02-20 14:3.	View P	ile -

The selected recording opens in the Analyze Menu. To add additional channels for comparative analysis (up to 4 channels), for dual channel analysis functions, etc: select Add Channel, then select whether to add another channel from the database or Browse for an external file (such as an .anl file of a data recording emailed by another user).

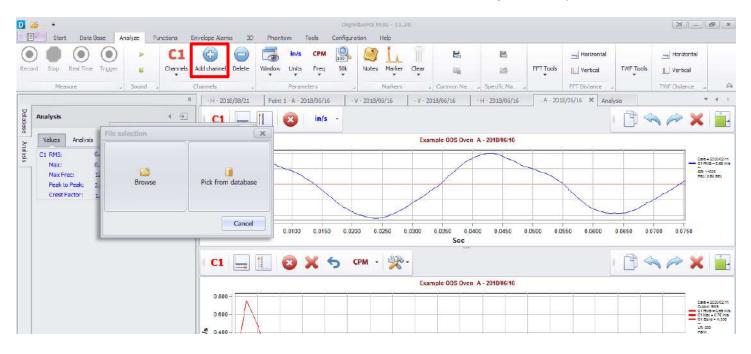

Viewing Vibration Data continued (M20, M30, Phantom)


Selecting and Zooming: Magnifying a desired section of waveform or spectrum can be accomplished in a variety of ways. To select a section of the waveform or FFT for closer inspection, press and hold the left mouse button then slide it along the graph over the desired section to magnify. When the left mouse button is released, the selected section will be magnified.

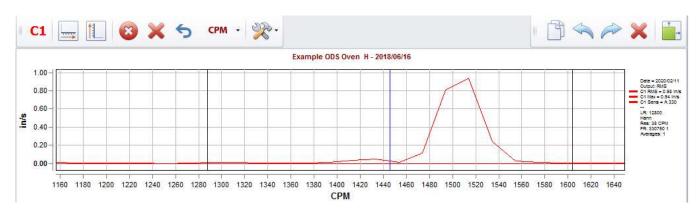

To increase/decrease zoom on only one axis, place the mouse pointer over the axis scale and roll the mouse scroll wheel.

To move the graph view while zoomed, place the mouse pointer over the desired axis scale. Press and hold the left mouse button, then drag the axis scale up/down or left/right


Floating zoom control buttons also appear automatically when the mouse pointer is positioned over an axis.

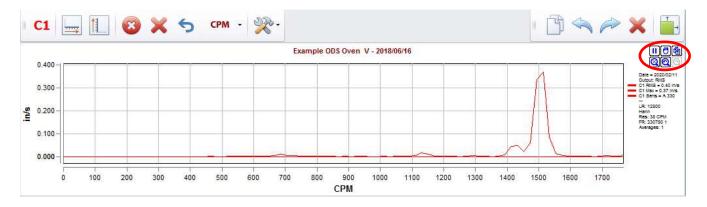

NOTE: Zooming in on any section of the Time Waveform automatically re-renders the FFT, which will appear to be at lower resolution than the FFT of the entire waveform.

Time Waveform/FFT Graph tools (M20, M30, Phantom)


A number of panel control buttons are located above each waveform/spectrum graph.

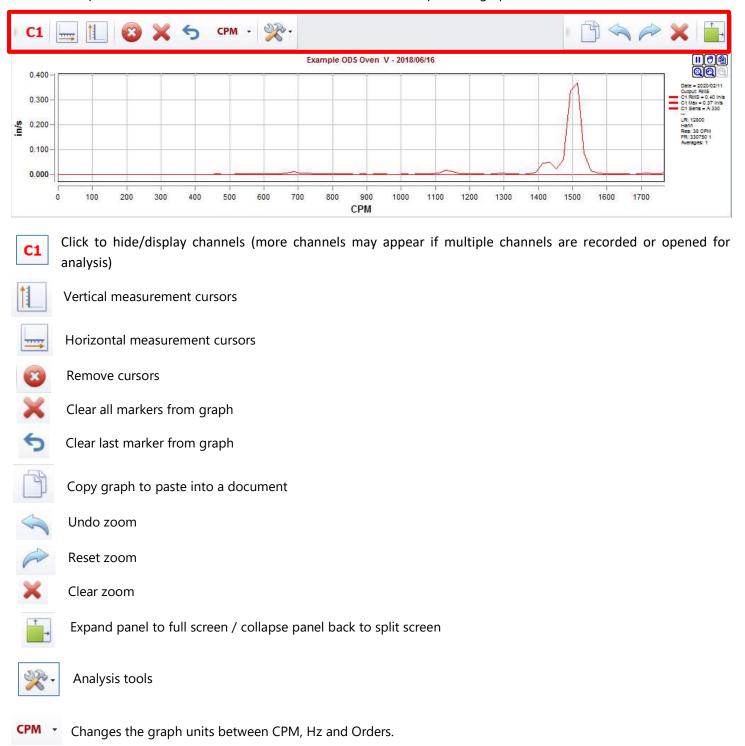

Units and FFT Spectrum Windowing (M20, M30, Phantom)

Because Erbessd Instruments technologies capture waveform data on each collection, a recording opened for analysis can be re-rendered immediately to suit user preferences.

- **Window**: Hanning is usually the default windowing view for FFT spectra. Other options include: Rect, Bartlett, Blackman, Hamming, Kaiser, CosSum and FlatTop.
- Units: Imperial and Metric amplitude units for Acceleration, Velocity and Displacement are available.
- Freq: Frequency units for Hz. CPM and Orders are available.
- Graph frequency limit: Sets the maximum frequency limit of the FFT graph (according to Freq units selected)
- Save personal configuration: Saves all the settings chosen in the previous buttons.
- Remove personal configuration: Deletes all the settings saved and restores them to default.

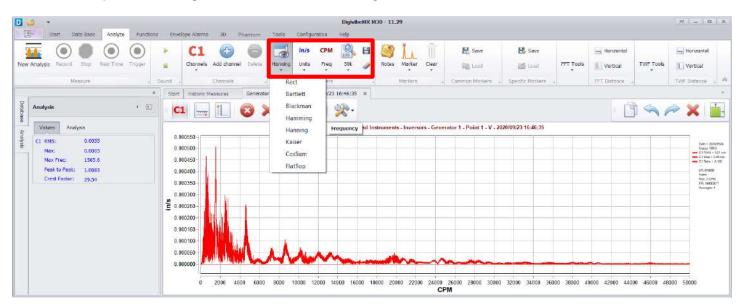


Analysis Menu Tools (M20, M30, Phantom)

The Analysis Menu toolbar features essential functions for analyzing collected vibration data:



Markers: Select Markers from the toolbar dropdown and click on any desired point in the FFT t o place a marker:

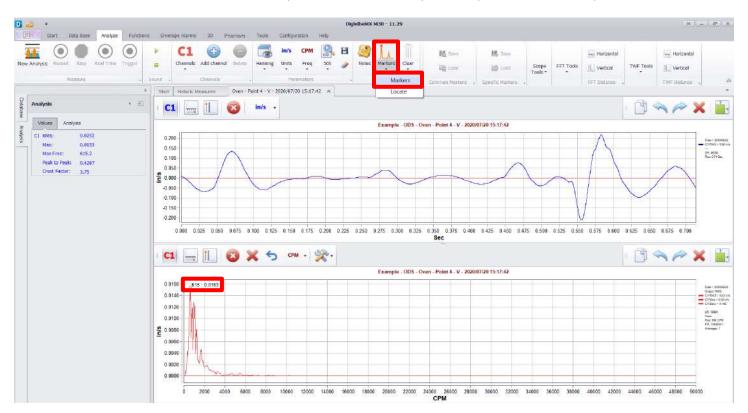


Common Markers: May be used to save and recall markers on future recordings for the same point and axis.

Specific Markers: May be used to save and recall markers for future analysis of the same recording.


Analysis Menu Tools continued (M20, M30, Phantom)

Scope Tools

This menu allows you to change the view of the classical FFT and TWF so you can work better with one or multiple channels at a time.

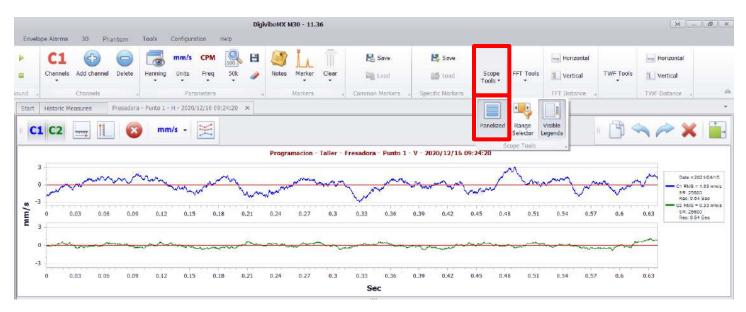

The **Panelized** tool allows you to visualize each channel on an independent graph. It divides the TWF and FFT graphs in to separate graphs for each channel.

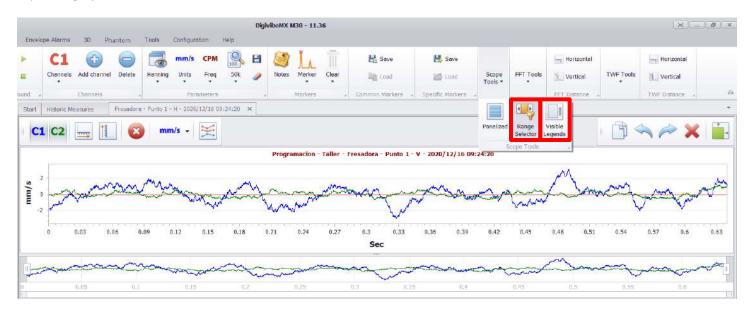


The **Range Selector** in a different kind of zoom that allows you to define a range of time or CPM (according to the graph) to visualize in the scope. The **Visible Legends** tools hides/shows the panel with the channel information that is on the right side of each graph.

FFT Tools

The FFT Tools dropdown menu contains several common tools for FFT analysis.


🖸 🥔 📰 🔹	nalyze Funct	oos Ernel	ope Alarms	30 Pha	antom	Tools Co	figuration	Help	Dig	ivibeMX I	430 - 11.	36							(3	<)).	€. ×
<u>.</u> • • (al Time Trigger	P	C1	Add channel	0	-	m/s CPN	100	8	Note s	Å Marker		H Save	E Save	Scope Tools *	FFT Tools	Horizontal	TWF Tools	Horizon		
Moesure		* Shund		Channels Is.res	+ Presedoro	- Punto 1 - H -	Peramotor 2020/32/16	à	x		Markors		Common Markers	 Specific Markans 		lin.	Lais.			9 4	3 7
Analysis Velus: Anelysis	+ 2		1	11	3	nm/s -	X									Harmonics	Sidebands Ave	rages Overlap	Decibels	×	

Harmonics: Specify the number of Harmonic cursor lines desired (8 in this example), then select the vibration peak from which harmonics will be calculated. Blue cursor lines the harmonic frequencies appears on the graph. Use Remove Cursors to clear cursor lines from the graph.

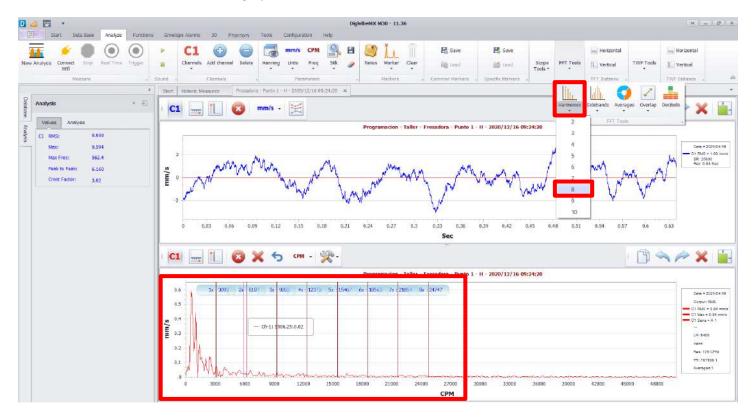


Analysis Menu Tools continued (M20, M30, Phantom)

Sidebands: Specify the number of Sideband cursor lines desired (3 in this example), then click the vibration peak to be analyzed for Sidebands. A blue line for each Sideband of the selected peak appears on the graph. Moving the mouse pointer laterally across the graph will expand/reduce the sideband spacing. When the desired sideband spacing is achieved, click again to freeze the sideband cursors in place. Use Remove Cursors to clear cursor lines from the graph.

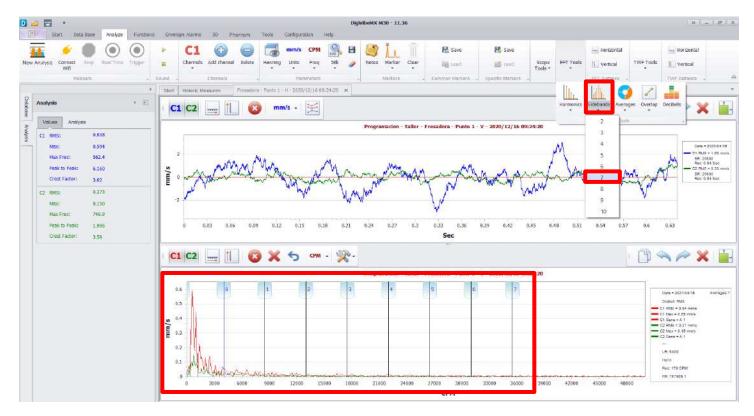


Averages: Specify the number of averages used to produce the FFT. The default FFT view is one average. Increasing the number of averages reduces the appearance of random outlying peaks and periodic occurrences, showing a truer representation of repeating events in the FFT. However, increasing the number of averages lowers FFT resolution.

This is the DigivibeMX[®] default FFT view, which is produced using 1 average:

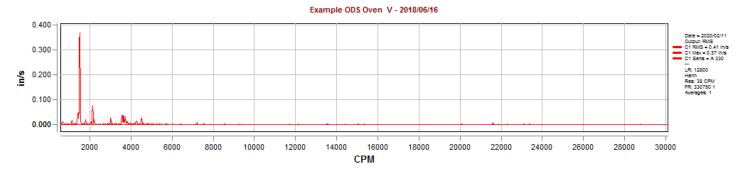

This FFT shows the same frequency range, but was averaged 10 times:



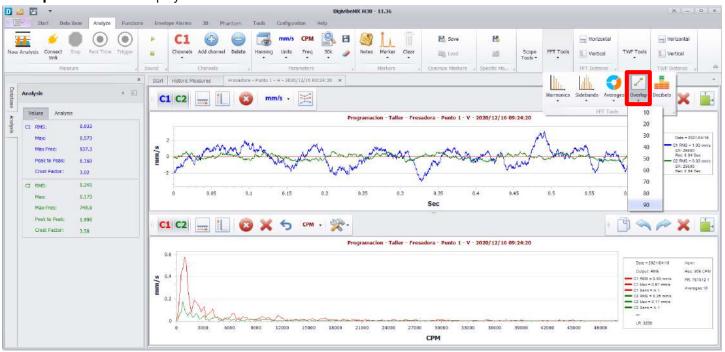

Overlap: Converts and displays the Waveform in Decibels.

Decibels: Converts and displays the FFT in Decibels.



TWF Tools

Transient: Select Transient.

D 🥌 🔽 =	ions Enve	alope Albrma 30	0 Phantom	Tools	Configuration		ligivibe	OEM XM	- 11.36								×	. o x
New Analysis Connect Stop Real Time Trage	Saund	Channels Add	C Contraction Cont	Henning	mm/s Cl Units Pr	req SOk	8	Notes	Markor Markor	Clear	E Save	E.	Scope Tools *	FFT Tools	Horizontal	TWF Tools	Herizontal	
Analysis (Values Andysis	* Stort		1		н - 2020/12/ Из -	-		ograma	don - Tall	er - Fres	adora - Punto 1 - V		:24:20		1	Groular TWF TWF Tor	ansierk 🗙	

Cursors window opens to the Transient tab. Click the desired frequency to analyze in the FFT. Then click the desired instance to inspect for transient events in the Time Waveform. Moving the mouse cursor laterally across the Time Waveform changes the sideband cursor frequency spacing. The sideband cursor frequency in the Cursors window indicates the sideband cursor spacing. (Zooming in on the affected part of the Time Waveform can help narrow down cursor spacing to the desired frequency interval). Use Remove Cursors to clear cursor lines from the graphs.


🗃 🛂 🔸 El- Start Data Sase Analyze Functions	Eligheinidet Math - E 1.3m Envelope Alarms 20 Phantom Toels Configuration Help	()() _ () _ ()
w Analysis Connect Strp Real Time Trigger		Horizontal Vertical
Wifi	Tools - Tools - Tools - Tools -	Distance +
а	Start Historic Messures Freesdora - Punte 1 - H - 2020/12/16 09:24:20 x	
Analysis • El	C1 C2	×
Values Analysis	Programacion - Taller - Fresadora - Punto 1 - V - 2020	
C1 RMS: 1.573	3.6 Mariers L Potence	
Max: 1.631 Max Free: 749.3		Dele = 2021/04
Max Frec: 749.3 Peak to Peak: 5.133	3.4 -0.5 - 🥥	8R 25600 Rec 0.04 Sec C2 RMD + 0.25 r
Crest Factor: 2,69	Disk.	SR 25000 Rec: 0.64 Sec
C2 RMS: 0.220	0.42011718771 : 3.02	
Max 6.171	E 0.484760225 1/2.50 L Max 3 Max 5 Max 10 Max	
Max Frec: 1498.5		
Peak to Peak: 1.220	2.5	
Crest Factor: 2.11	Cose	
	0.45 0.46 0.47 0.48 0.49 0.5 0.51 0.52 0.53 0.54 0.55 0.58 0.57 0.58 Sec	
	C1 C2 🔜 📋 😆 🗶 5 🚥 - 🎇 -	×
	Programacion - Taller - Fresadora - Punto 1 - V - 2020/12/16 09:24:20	
	1 Dawn = 202106116 C1 RM3 + 1 87 mm3 C2 RM3 + 8.22 mm3 - Hanne 0 June 1 (83 mm3) C2 RM3 + 8.22 mm3 - Hanne 0 June 1 (83 mm3) C2 RM3 + 8.22 mm3 - Hanne 0 June 1 (83 mm3) C2 RM3 + 8.22 mm3 - Hanne 0 June 1 (83 mm3) C2 RM3 + 8.22 mm3 - Hanne	PN Averagea
	8 5008 18600 15606 20606 25600 30606 35606 46609 45600 56009 CPM	

Circular TWF: Opens the Select Frequency window. Select the desired frequency from the dropdown or enter it manually.

NOTE: If the Analysis view contains multiple channels, all channels will be rendered in the Circular TWF graph.

🚹 🔶 💻	() () 🕨		(\Box)	1	mm/s	СРМ	100		1	Ĭ.	iii -	🛃 Save	E,			Horizontal		Horizontal	
New Analysis Connect Pleas	e pick a frequency			×	Units	Freq	50k	2 1	Notes	Marker	Clear	in Lond	16	Scope Tools *	FFT Tools	Vertical	TWF Tools	Vertical	
h		2			Paran	netera				Markors	+	Common Markers	. Specific Mo			TET Distance		TW/F Distance	. 6
	Start	1796.677	-	2	H - 2020/1	2/16 09	:24:20 >												
Oageboon		picked by selecting or		•	n/s - [X										E.		P ×	
직 Values Ana	point in FFT or by s time wave form	selecting 2 points in t	:he					Progr	amaci	on - Talle	r - Fresi	adora - Punto 1 - V	2020/12/16 09:	24:20					0 0
	une were form																		

The Circular TWF is rendered in a new tabbed panel, based on the selected frequency. Graph Appearance options include Line, Area or Points. Frequency, Start time and Cycles can all be changed after the graph is opened. Changes will be re-rendered immediately. The Copy button allows copying the graph for pasting into a Word document, email, etc.

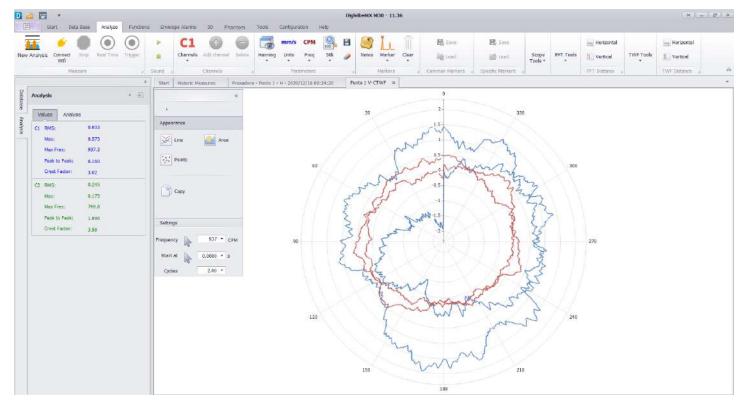

TWF Distance/FFT Distance: Calculates and displays the horizontal or vertical distance between any two selected points on the Time Waveform or FFT graph. Use Remove Cursors to clear marked areas from the graph.



Functions Menu Tools (M20, M30, Phantom)


In addition to the Analysis Menu, the Functions Menu also features a number of essential tools for analyzing collected vibration data: The Functions Menu tools are divided between two toolbars: Single Channel functions and Dual Channel functions.

Single Channel Functions toolbar

The following tools are provided for single-channel analysis.


Circular TWF: Explained previously on Pg. 70. (If multiple channels are opened in Analysis, all will be rendered)

Waterfall: Produces a color-coded 3D representation of a recorded signal as both Time Waveform (0-pk) and FFT. This unique tool allows users to observe how frequency amplitudes in the FFT may fluctuate over time.

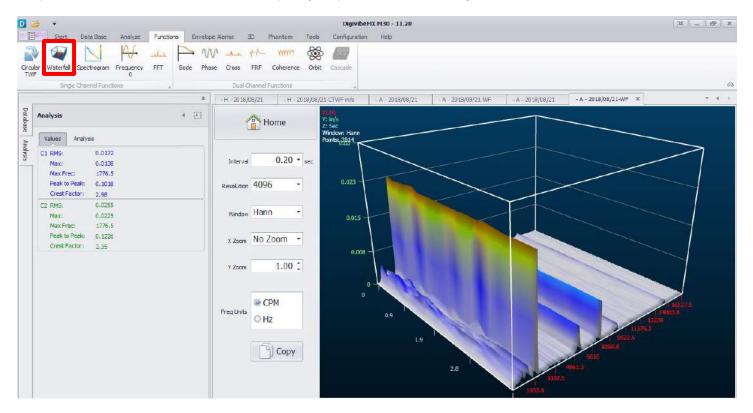


Spectrogram: Produces a color-coded bar graph representation of vibration severity by frequency range. Interval, Resolution, Windowing format and Frequency units may be changed. The graph will immediately re-render. The Copy button copies the graph for pasting into a Word document, email, etc.


NOTE: Lines may initially appear very small. Zoom the view as necessary. Position the mouse pointer over the desired axis and scroll up/down to zoom the axis in/out. Click, hold and drag an axis in the desired direction to reposition the graph.

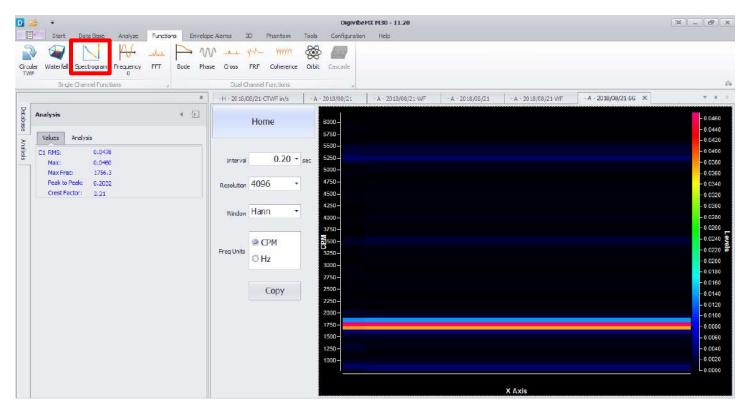

Frequency 0: Opens a small window displaying the Cross-by-0 Frequency.

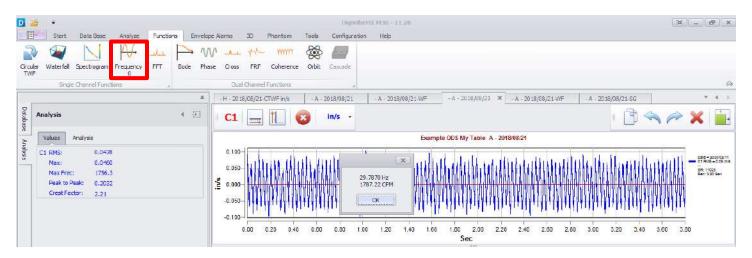


FFT: Displays the FFT with additional dropdown options to convert between Power, Real, Imaginary and Phase views.

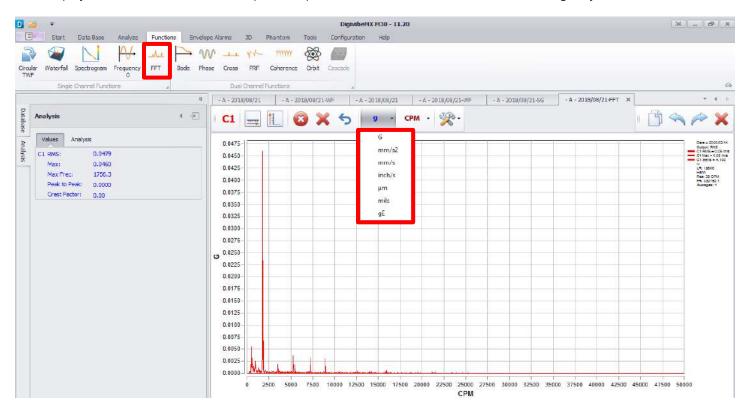


Dual Channel Functions toolbar


The following tools are provided for dual-channel analysis.

Bode: Displays machine start-up or run-down data collections in Bode Plot format. (Open vibration data, add speed data channel, select Bode, select Channel 1 for vibration – Bode plot opens. Select how you would like data to be plotted.)

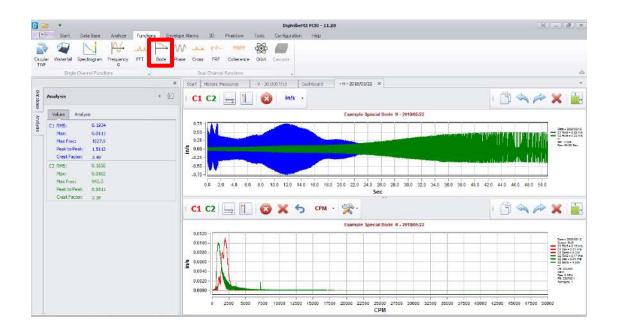


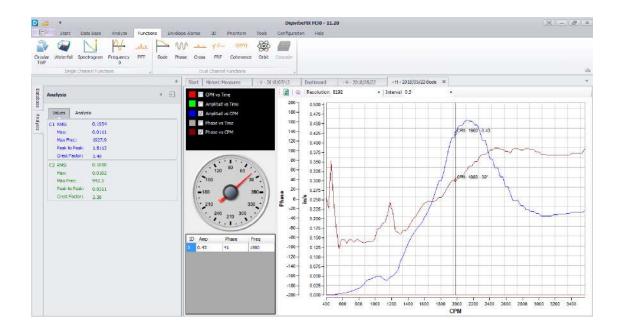


Phase: Displays the phase angle differences between a measured point and its reference point, across the entire frequency spectrum.

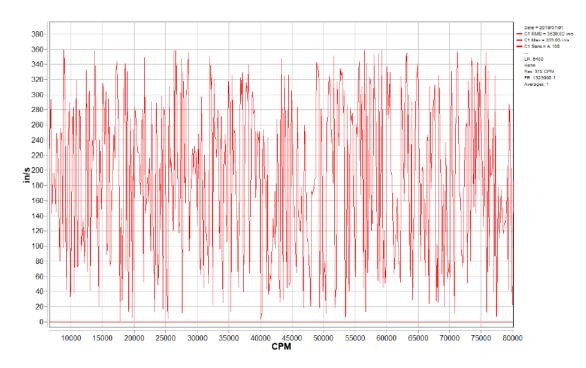


Cross Spectrum: Displays two channel data as a Cross Spectrum FFT graph.

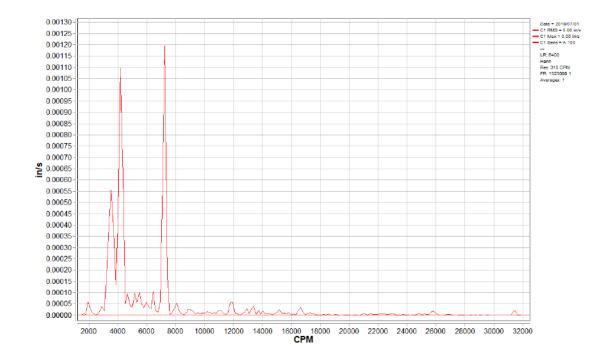

FRF (Frequency Response Function): Displays a FFT-style graph measuring the output spectrum of a system, in response to a stimulus.

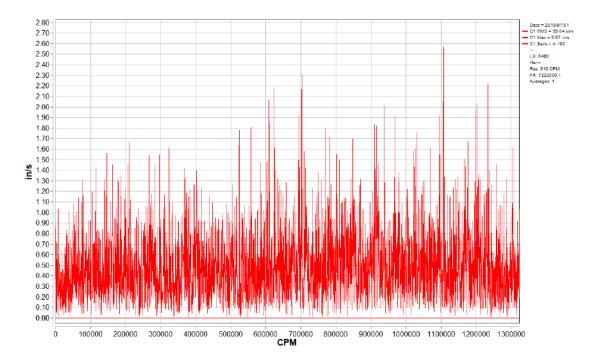

Coherence: Displays a spectral representation showing the relationship between two signals or data sets.

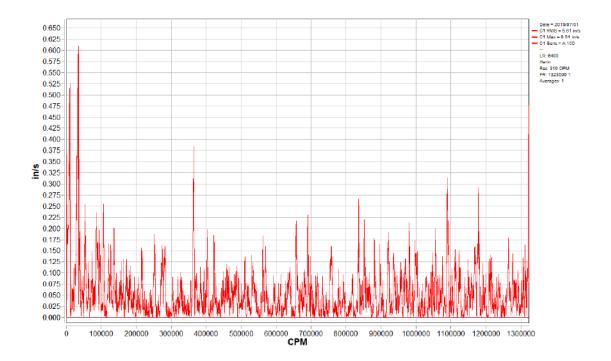

Orbit: Displays a static or dynamic graph representing the end travel of a rotating shaft.

NOTE: Orbit Analysis requires simultaneous data collection in the vertical and horizontal planes. In order to accomplish this, one would need triaxial, biaxial or two single-axis accelerometers. A single triaxial or biaxial accelerometer could be positioned vertically. With two single axis accelerometers, one must be positioned horizontally and the other vertically – each collected on its own channel. Start a new analysis and collect both channels simultaneously.

Create an orbit plot from the data by clicking on the Orbit button located in the Functions Menu toolbar. If the collected data is identified as Horizontal and Vertical, DigivibeMX can determine which channel is vertical and which is horizontal.



In the orbit view, the duration of the drawing can be adjusted in milliseconds. The rendering speed of the graph can be adjusted by percentage. It is also possible to zoom in to fit an appropriate size. The image can be copied from DigivibeMX[®] with the right mouse button and pasted elsewhere as a still image.

Observe the dynamic graph in video format by clicking the Start button. Playback can be paused and restarted at any point. A slider bar under the Pause and Stop buttons can be used to manually scroll through the entire Orbit plot.

Below the configuration settings on the right-hand side are Filter tools that can be used to filter Low Pass, Pass Band, Pass High and Block Band to improve the graphical interface.

Alarms Menu Tools (M20, M30, Phantom)


Overall alarm values for Displacement, Velocity, Acceleration and Acceleration alarms can be set for Machine Points when a new Machine is created in the database. These alarms are useful for ensuring that any source of vibration across the entire FFT spectrum will trigger a change in the Machine's alarm status. However, due to their unique design, installation or functions, some machines simply do not run within normal parameters across all frequency ranges. In such cases, a user may want to wrap an alarm envelope around an existing "ideal state" data collection. They may also wish to reduce or increase alarm tolerances at certain frequency ranges. Capabilities to establish and monitor these types of customized alarms are provided on the Alarms Menu. To set a new alarm envelope around an existing data collection, first use Open Files and select View File to open the desired recording. Then proceed to the Alarms Menu.

Show Alarms toolbar

The following tools are provided to view or hide alarms that are set around a recording.

Show Alarms: Displays all envelope alarms set on the open recording (if any alarms have been set).

Green / Yellow / Red: Toggles on/off the individual Green, Yellow and Red alarm envelopes.

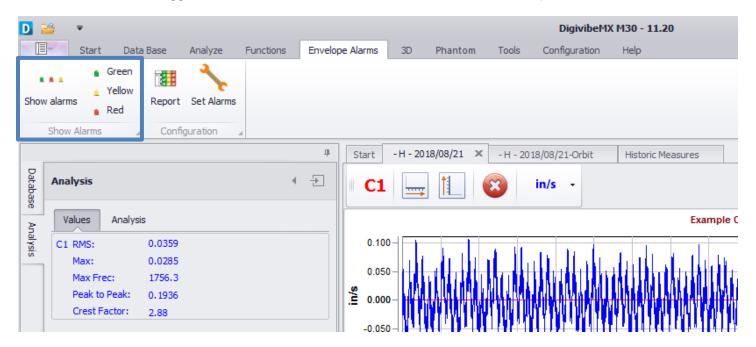


Configuration toolbar

The following tools are provided to set an alarm envelope around a recording, view available alarms and provide an overview of the Machine's current envelope alarm conditions.

Report: Displays the envelope alarm status of all Points and Axis for the Machine to which the current recording belongs.

Available Alarms: Displays the alarms that are compatible with the Machine to which the current recording belongs.

Set Alarms: Opens the Alarms Wizard to establish or edit an envelope alarm around the displayed recording.

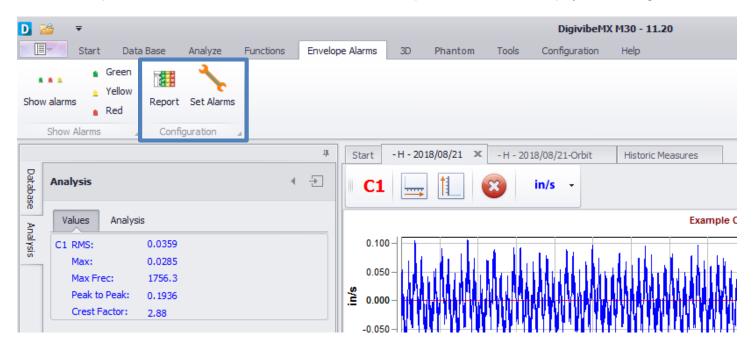


Setting an alarm envelope around a recording

With the desired recording open, select Set Alarms.

D 🐸 🤹	•									DigivibeM	K M30 - 11.20
•	Start	Data	Base	Analyze	Functions	Envelope Alarms	ЗD	Phantom	Tools	Configuration	Help
Show alarms		Green Yellow Red	Report	Set Alarms							
Show A	larms	1	Config	juration ,	4						

The alarm enveloping window opens, displaying the Machine and Point to which the recording is assigned. The arrow buttons can be used to advance to the previous or next Point in the database. Units appear as displayed in the original Analysis window but can be changed to alarm the recording for Displacement, Velocity, Acceleration or Acceleration Enveloping. To set the alarm envelope parameters, click the Wizard button to launch the Envelope Alarms Wizard.

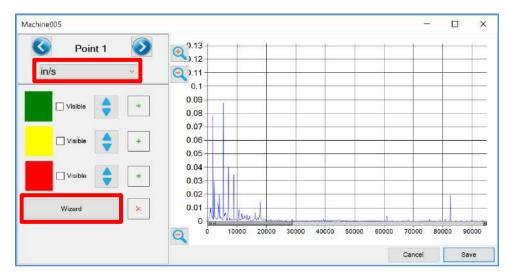

Use the Envelope Alarms Wizard to specify the increased vibration tolerance across the entire FFT Spectrum, before an alarm condition changes. These values may be defined by a percentage increase or an absolute value. Minimum indicates the amount of resulting alarm envelope from the highest amplitude documented in the enveloped recording. Checking the boxes displays the checked band on the Alarm Enveloping window reading. When satisfied with the overall envelope parameters, click Next to proceed.

NOTE: Alarm envelopes can be adjusted at specific frequency ranges later in the process.

%	15	-	
Absolute	0	-	
Minimum	0.0118110	•	
%	50		
Absolute	0	-	
Minimum	0.0236220	•	
%	120	-	
Absolute	0	-	
Minimum	0.0472440	-	

The next screen allows users to select the number of peaks to be alarmed. Indicate the desired number of peaks to alarm, then click Next to proceed.

Envelope alarms wizard			×
Select the number of peak	is to detect		
0 5			
10			
0 15			
O 20			
O Custom 10	V	A	
	C 3		

The next screen allows users to specify the frequency range to be included around each enveloped peak in the FFT Spectrum. When satisfied with the overall envelope parameters, click Finish.

Colored the environment			5	
Select the envelop	ing rreque	ency range		
O +- 100				
O +- 200				
• +- 500				
O +- 1000				
O Custom	500	-	-	



The alarm enveloping window now displays the new envelope alarms around the FFT Spectrum.


To adjust the alarm bands in specific frequency ranges, click and hold the red x on the desired alarm envelope nearest the beginning of the desired frequency range. Drag it to the desired frequency and amplitude, then release. Then click and hold the red x nearest the end of the desired frequency range and drag it to the desired location, then release. Click Save when finished to save the envelope alarm.



3D Menu Tools (M20, M30)

ODS

Operating deflection shape (ODS) Is a type of analysis capable of animating the deformation of a mechanical system at a selected frequency. The ODS analysis animates the machine's movement at each measurement point during operation, relative to a common stationary point. These animations can be very useful by defining areas of structural weakness and identifying areas of mechanical clearance. In resonance cases, the ODS analysis can provide an estimate of the mode of vibration of an excited natural frequency.

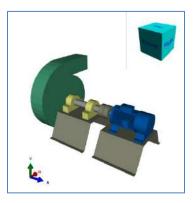

ODS Modeling Requires Reference Channel Data

At the present time, Reference Channel data collection is only possible in Route mode, using portable interfaces. The Phantom system is not capable of collecting the simultaneous Reference Channel data that corresponds with Phantom Vibration triaxial or biaxial sensor data collections.

ODS modeling data may be collected as part of every data collection Route, simply by adding simultaneous Reference Channel data collections to be recorded at each point. With Reference Channel data collection enabled, an extra Reference Channel accelerometer must be placed somewhere on the machine near the vibration data collection points. The Reference Channel accelerometer remains in place while all other machine data points are collected. This allows the vibration at all measured points to be compared with the stationary reference point, and therefore




compared among themselves with the reference point acting as a constant. The Reference Channel is indicated in the software with the letter "R".

Adding a new 3D model to the database

It is possible to add new 3D models from a local file to our database, you have to select the Machine where you want to add the model and click on the ODS button from the Start Menu or from the ODS tile.

This will open the ODS window and display that the machine doesn't have a 3D model assigned. In the New 3D Object window you can choose between 3D models loaded in the system (From Gallery) or a 3D model that is local based (From File).

Clicking the From File button will open the file selection window for the 3D model. Choose the desired 3D model and click Open:

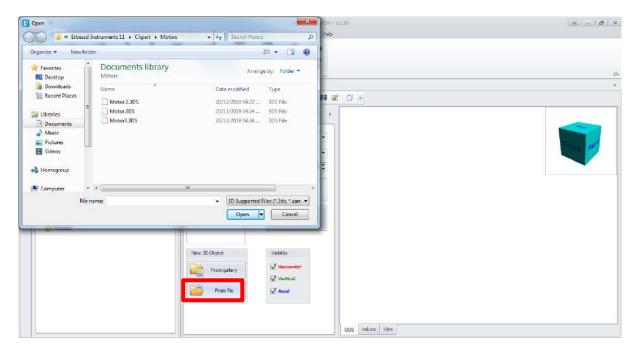


Probably the most important of all 3D ODS components is the rotating cube. This cube allows rotation of the 3D model in any direction. Click on the cube and drag it in any desired direction to rotate the model view. Another way is to click on any face or edge of the cube. The figure will automatically rotate until it is in the selected position.



In the top menu you will find the following buttons:

- Jisplays all 3 axes. If an axis direction does not match the direction data was collected, it can be inverted.
- HV Invert the Horizontal and Vertical axes.
- HA Invert Horizontal and Axial Axes
- VA Invert the Vertical and Axial axes.
- Export animation to AVI video format.
- Export animation to GIF animated image format, this option greatly reduces file size.
- Export picture in static image format jpg.

In the lower panel you will see the number of vibration points assigned to this image, each row corresponds to a point. You can see the location of each point by selecting the corresponding number.

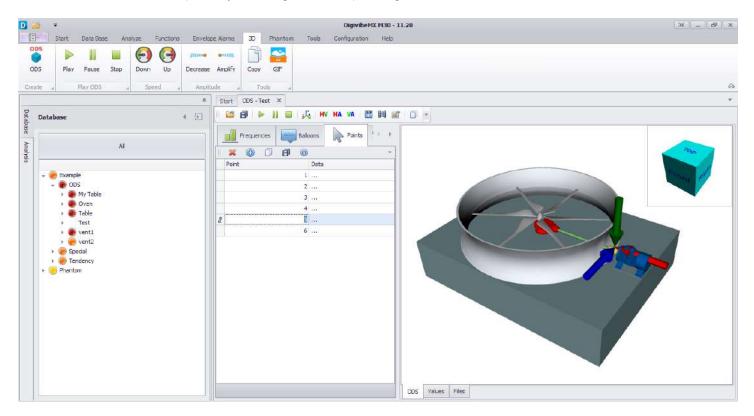

To change the axis orientation of a point or the location of the point itself you can click the "..." button and the following dialog box will appear.

Point Index 5	X Y Z	18.1962	Locate	
Horizontal	1	/ertical	Axial	N
Amp Phase Freq		Phase Freq	Amp Phase Freq	

Here you can invert the axis at each point by checking the Inv block. You can also change the axis location on the model, add or delete information for each axis.

To establish the location of the point press the "Locate" button and it will begin to change color, at this moment select a point directly on the figure and the location will be in the boxes corresponding to X, Y and Z.

Clicking Locate on the 3D model allows you to locate the point just by clicking on the desired part of the machine. This will open the Point window to specify whether the point is in the center of the figure or at a selected point.


Center of figure Selected point	Point	t		\times
	[Center of figure	Selected point	

Check where are the points located and placed them in the desired position selecting the number of the point you want to locate.

Once that the 3D model and the points are set, click on the Save button. This will open the Save Clipart window, here we can add a Category and write a Name for the New 3D model.


🖸 🍻 🔻	Dispublic CONTROL - 11.20 De Alarme 30 Phantom Tools Configuration Help	X _ P X
OOS Play Pause Stop Down Up Decrease		
Oreate a Ray ODS a Speed a Ampliti	ude Tooli	A *
Database Al Image: Second se	Point Projuences we Balloons Points	

Once that the clipart is saved in our gallery, you can use the same model for other machines with the From Gallery button. Using the plus button you can choose the 3D model recently created, you can find it in the Erbessd Instruments folder from My Documents. This way you can select the 3D model from the Category it was assigned.

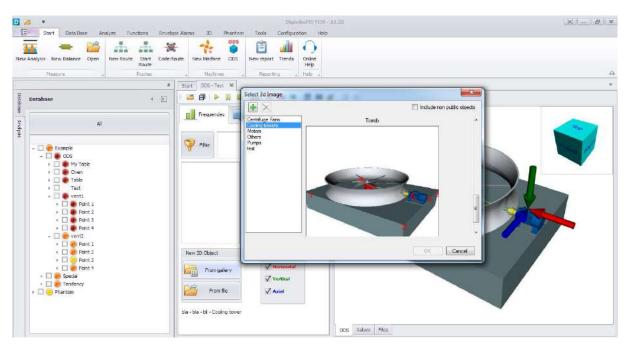

Collecting Data for 3D Simulations (ODS)

For 3D ODS Simulation, measurements need to be taken with 2 accelerometers on a data collection route with R reference point selected. Sensor 1 (single-axis or triaxial) collects data from all points and axes indicated by the route, while the 2nd sensor (single-axis) stays in the same reference location for all data collections. The reference location can be anywhere on the machine that vibration can be safely captured, without interfering with collecting route data points. **Do not** use route data collection points as reference points.

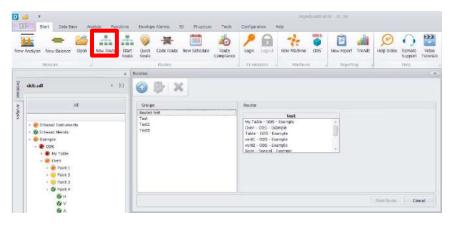

Click the New Route button to open the Routes window, here you can select from all the routes in the database.

To add a new route, click on the plus symbol button and it will open the New Route window.

	Info
Erbessd Instruments MID	Group Create route schedule
🔲 Erbessd Mérida	Name Pruebas
dwedwe	SampleRouteGroup
SampleCompany	Mach Sdfasf
Turbomequines	
	Machine settings Reference Channel No
	and the second se
	Reference Channel No
	Raference Channel No
	Raference Channel No Lines * Averages *
	Raference Channel No
	Raference Channel No Lines * Averages *

In this window you can choose between all the assigned machines of the database. In the Group dropdown you can choose between and existing route group or create a new route group. In the Name box you can identify the route with any name.

With the "**Create Route Schedule**" you can determine a programmed route. When you press the button you will open a window that allows you to program your routes daily, monthly, annually or in a personalized time.

It allows the selected machines to our new group along with its corresponding Points.

K Deletes machines that were already added to the group.


Allows the user to change the level or priority of the machines added to the new route.

In the Machine Settings menu you can choose between having a Reference Channel or not, choose the Resolution Lines from the dropdown menu, determine a Max Frequency, the number of averages to use and the Overlap percentage of the new group.

					×
Info					
Group	My New Grou	p	•	Create route schedule	e)
Name	Route 1				
Mach	iines				
	> 🗙		₽		
Second Second	-Mecanica - M	ecánica - I	Erbessd Méri	da	
Ŧ	Point 1				
Mach	ine settings				
	ine settings ence Channel		Yes		
	ence Channel	102400	Yes		
	ence Channel	102400	Yes		
	ence Channel Lines		Yes		
	ence Channel		Yes	· ·	
	ence Channel Lines	1	Yes		
	ence Channel Lines Averages	1	Yes		
	ence Channel Lines Averages	1	Yes	▼ ▼ ▼ Cance	

Clicking the Ok button will open the Routes window where you can see in the boxes the new group and the machine assigned to that group. Select the new Route and click Ok.

Routes		X
🔂 🔯 🗶		
Groups	Routes	
Routes test Test Test2	Route1 vent1 - ODS - Example	
Test5 My New Group		
	Ok	Cancel

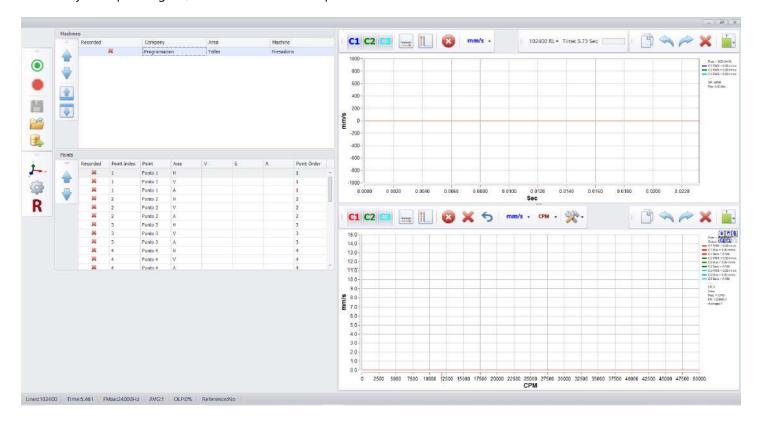

Inmediatly after pressing Ok, the next window will open:

In this window we can see the recorded signals from the Route and the R button to activate our Reference Channel.


Real ODS

The new feature on DigivibeMX allows you to take measurements on the go and make an ODS simulation with them with the Real ODS tool.

) 👛 🖻	Ŧ										Digi	vibeMX M30 - 1	1.36						
(Be)	Start	Data Base 🛛 A	Analyze Funct	ions Envel	ope Alam	ns 30	Phanton	Tools	Configuration	Help									
-			-		-	0	620 286		10	۶	0	-	ODS	ODS	Ê		R	0	***
iew Analysi	s Open	Multiple File Selection	New Balance	New Route	Start Route	Quick Route	Code Route	New Schedule	Route Compliance	Login	Logout	New Machine	ODS	Real Time ODS	New report	Trends	Help Index		Video Tutorial
	Measure		Balencing				Routes			EI-Ana	evtice		Machine		Reporti	ha 4		Help	


In the Start Menu click the "Real ODS" button to access to the Real ODS window. Here you will find the same options that you can find in the ODS window for route measurements.

When selecting the "Frequencies" tab you can choose between selecting an image from the gallery or uploading a new image from your computer (following the steps mentioned on page 84).

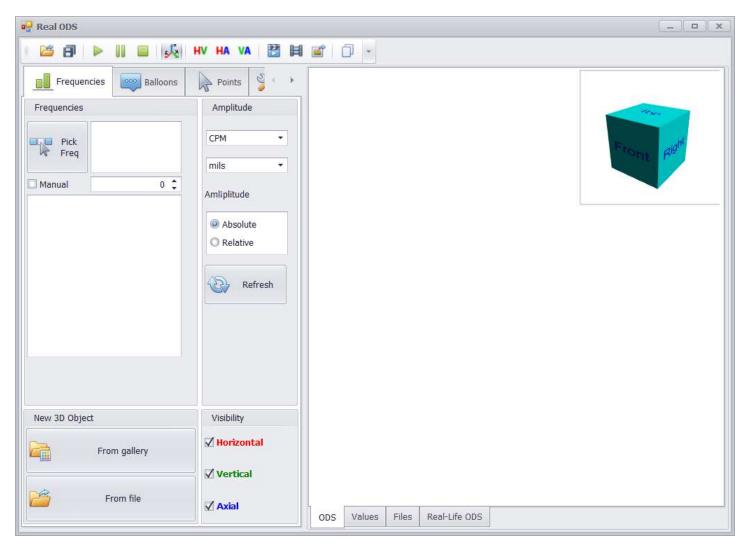

Once that the figure is selected for your measurement. You can add or remove measurement points with the "Points" tab.

Now that our figure and our points are set up; you can start recording your measurements in the "Recording" tab. Here you can find the main configuration for your recordings.

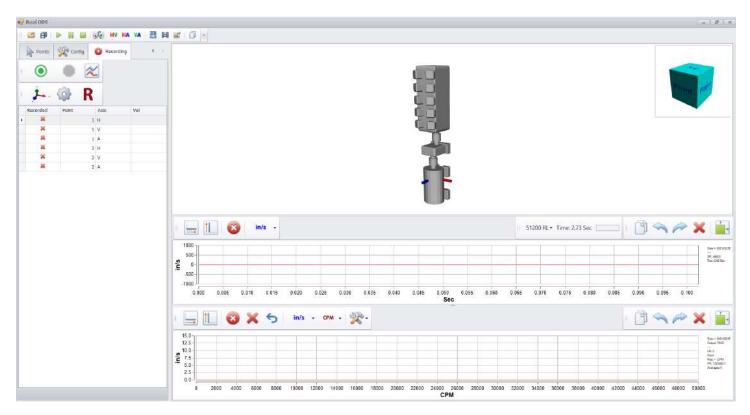




Record: Allows you to start the recording in a selected point.



 Stop: Allows you to abruptly stop any active recording.





Triaxial: Allows you to set the recording in three simultaneous axis.



Orientation: Allows you to change the direction in which your sensor is placed.

Scheduled Routes

When you save the a new route, the software will automatically ask you if you want to create a schedule for that route, if you choose no; then you have the chance to do it later with the "**New Schedule**" button.

D 🐸 🖾	Ŧ										Digi	vibeMX M30 - J	1.36						
	tart i	lata Base 🛛 🥖	Analyze Funct	ions Envel	ope Alam	15 30	Phantor	n Tools	Configuration	Help									
	1		-	1.		0	10x0 2110		0	۶	0	-	ODS	ODS	Ê	all	A	0	>>> >>>
New Analysis	Open	Multiple File Selection	New Balance	New Route	Start Route		Code Route	New Schedule	Route Compliance	Login	Logout	New Machine	ODS	Real Time ODS	New report	Trends	Help Index		Video Tutorials
1	leasure		Balancing				Routes			El-An	alytics .		Machine	5 4	Report	ing 🚽		Help	

Pressing this button will open the schedule window. Here you can locate each route in the group where you have it saved. With the dropdown menu you can chose the scheduled frequency of the route. You can scheduled them daily, monthly, annually or in dates determined by the user.

chedule a route					
General					
Group:	Schedule	•			
Route:	Route 1	•			
Schedule Type:	Daily	•			
	Daily				
It will be schedu	Monthly Annual	unched	k the days to schedule.		
Monday	Custom				
☑ Thursday ☑ Friday ☑ saturday ☑ sunday					
			Save	4 c	ancel

Once that you have selected the days or dates on which you want the route to be scheduled, click "Save".


To check the state of your programmed routes, press the "Route Compliance" button.

1 🐸 🔛	Ŧ										Digi	vibeMX M30 - J	1.36						
	Start	Data Base 🛛 A	nalyze Funct	ions Envel	ope Alam	15 30	Phanton	Tools	Configuration	Help									
346			-			0	670		0	۶	0	-	ODS	ODS	Ê	ali	R	0	>>>
ew Analysis	Open	Multiple File Selection	New Balance	New Route	Start Route	Quick Route	Code Route	New Schedule	Route Compliance	Login	Logout	New Machine	ODS	Real Time ODS	New report	Trends	Help Index		Video Tutorials
	Measure		Balancing				Routes		_	EI-An	dytics .		Machine		Reporti	ng u		Help	

This will open the graph compliance window. Here you can see all the routes grouped in three different categories

depending on the compliance status of your route.

The three status that you can find in this window are:

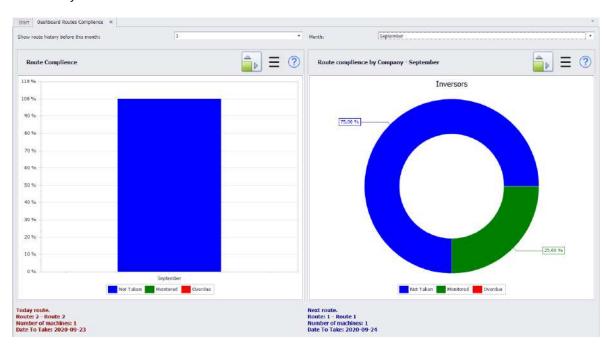

- Not taken: In this color you will find every scheduled route that are pending to measure..
- Monitored: This color will group every programed route that have already completed all the days of its schedule.
- **Overdue:** In this color you can find every route that wasn't taken on the day that they were programed and so they are delayed or overdue.


In the lower bar you will see defined which is the next route to take today and which is the next one that hast to be taken indicating date and number of machines.

When you click on any graph, you will see the machines on where that graph was made. You will see all the machines assigned to that route.

Back nplien	ce			Bade npl	ience <mark>b</mark> y Company - <mark>Septemb</mark> e	r	a = (
chine Name •				Machine Name	-		
rea	Machine Code	Date To Take	Date Taken	Area	Machine Code	Date To Take	Date Takon
Machine Name:	AC-Almacen			+ + Machine Nat	me: CarlosMachine		
Machine Name:	AC-Electronica						
Machine Name:	AC-Mecanica						
Machine Name:	Compresor						
Machine Name:	Esmeril						
Machino Itamo:	Fresadora						
Machine Name:	Generador CIIC						
Machine Name:	Torno						
Machine Name:	Ventilador Area Soldadura						
Machine Name:	Ventilador CNC						
Machine Name:	Ventilador Fresadora						
Machine Name:	Ventilador Torno						

Analysis of ODS Data


Select the machine you want to analyze and start the **ODS** function:

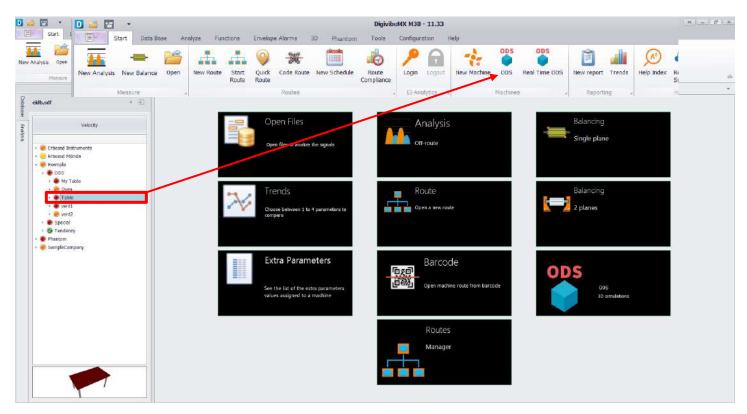


Select ODS data collection route by date and RPM.

D 📾	580	DigivibeMX M30 - 11.14	× = a ×
(B)-	Start Data Base Analyze Functions	Alams 3D Phantom Tools Configuration Help	
005	Play Pause Stop Down Up	Decrease Amplify Copy GIF	
Create	Play 005 . Spred	Ampiñude . Tools .	A
		Start ODS-venti *	
Database	tabase (🕮	- 😂 🗗 🕨 🖩 🚮 HV HA VA 🛅 🗐 🛒 🗇 🕒	
	Alf	n Bailoons Prints Config:	
	Example - CDS - My Table - Oven - Table - vent - Point 2 - Point 3 - Point 4 - vent2 - Special - Bump Test - Rum Down Crbit - Tendency - Machine 1	2018/07/13 09:38 CPM Imils Imils 1296.7 Imils 566.2 Absolute 566.2 Relative 787.3 Refresh 110.3 Visibility Visibility Hortzontal Visibility Visibility From gallery Visibility Y Vertical V Axtal 005 Values 005 Values	

Select Play to begin the ODS animation of collected data.

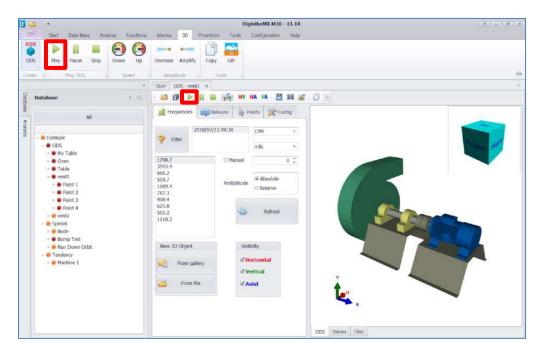


The animation speed of the ODS model can be increased or decreased using the Down or Up controls. The effects of vibration can be reduced or increased with the Decrease or Amplify controls. A still image or moving .gif file can be copied for Word documents or emails using the Copy or GIF controls. Axis of orientation can be swapped as desired.

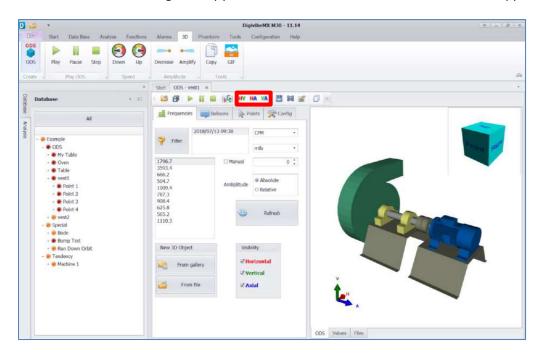

Phase Analysis of ODS Data

Select the **Points** tab and click on the **Data cell** of the point you want to analyze:

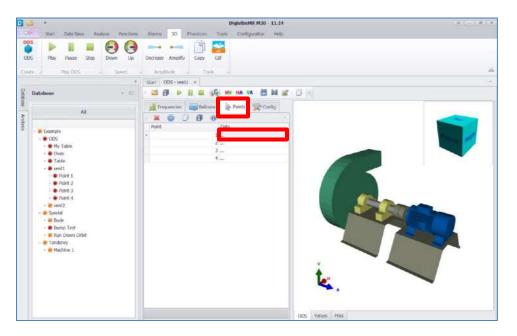

- The phases are calculated between all points with respect to the Reference:
- Horizontal
- Vertical
- Axial


Subtract the phase of the point and direction that interests you with respect to the 2nd point of interest and thus obtain the phase between them (for example the Phase between 1H and $1V = 358^{\circ} - 238^{\circ} = 120^{\circ}$).

IMPORTANT: Make sure that the measurements were taken in the directions indicated in figure 3D, otherwise select the "Inv" box to reverse the direction at a given point (the arrow changes direction).

Point Info		×
Name 1	Position X 54.2803 ↓ Y 5.0264 ↓ Z 2.1428 ↓	Locate
Horizontal	Vertical	Axial
🗙 🃲 🔲 Inv	🗄 🗙 🍽 🔲 Inv	: 🗙 🎫 🗌 Inv
Amp Phase Freq 1.6. 358 79	Amp Phase Freq 0.74. 238 179	Amp Phase Freq 0.8. 326 79
	(Ok Cancel

Route Data Collection (M20, M30)

Machines in the DigivibeMX database are rarely displayed in the same order that their data would be collected. DigivibeMX allows Machines and Points to be grouped an organized into logical Routes that a technician would travel for fast, efficient data collection with portable instrument such as WiSER, WiSER3x or the GX-400 wired interface. To create a new data collection Route, select New Route from the Start Menu options or select the Routes Manager tile.

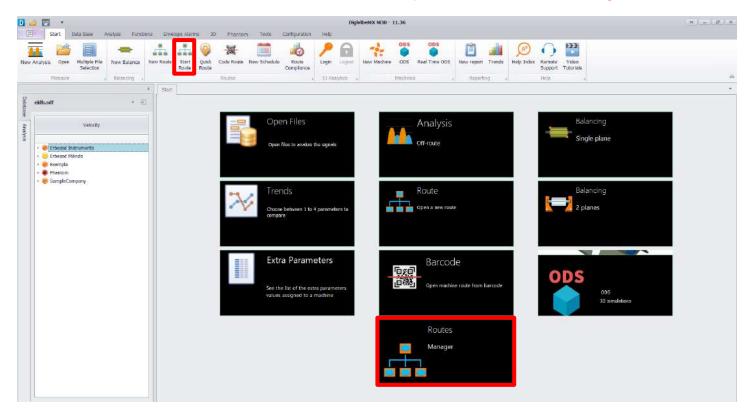

Advance Tendency (M20, M30, Phantom)

On the Tools menu, select the Advance Tendency icon

con Advance Tendency


to open the Dashboard window.

The Dashboard window contains 5 panels of Severity information. Severity values provide an indication of overall machine health and should not be confused with the values of collected data (vibration, temperature, etc).

Severity values are as follows: 0-1=Inoperative, 1-2=Excellent, 2-3=Satisfactory, 3-4=Unsatisfactory, 4-5=Poor


- Data panel Displays the average severity of machines or points under the database level selected, for the slope interval specified in machine configurations.
- Severity panel Chart display of the average severity on machines or points under the database level selected, for the slope interval specified in machine configurations.
- Last Severities Average panel Displays average severity based on the most recent data collection.
- Severity & Slope panel -
- **Trending** panel Displays a severity trend for all historical readings in the database.

The data displayed is determined by the database level selected – Company, Area, Machine or Point. Clicking the arrows button on any panel opens it to a full-size window view.

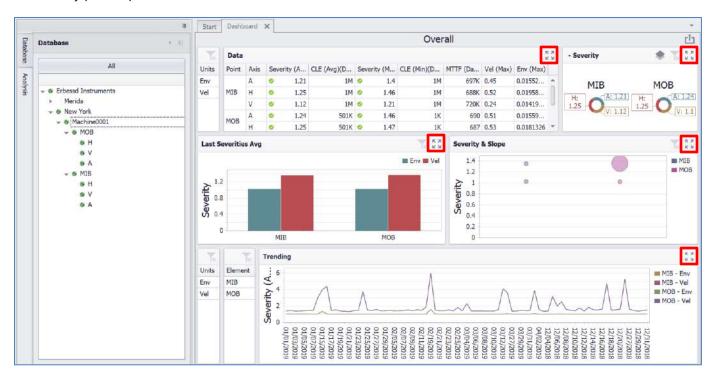

Advance Tendency continued (M20, M30, Phantom)

Data panel

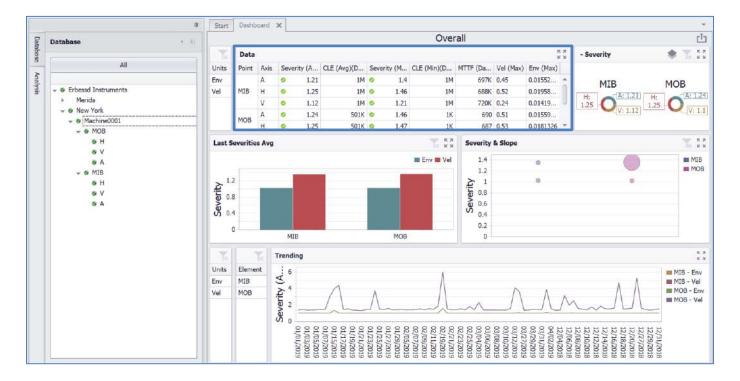

The Data panel provides a tabled overview of machine health data for the database level selected, as follows:


- Area: The area in which the data was collected. (When database level Company is selected)
- Machine: The machine on which the data was collected. (When database level Company or Area is selected)
- Point: The monitoring point where the data was collected. (When database level Area or Machine is selected)
- Axis: The direction in which the data was collected. (When database level Machine or Point is selected)
- Severity (Average): Average severity is calculated using the most recent RMS values collected, versus the ISO or User-defined alarms for the specified slope interval (days) in the machine's Configuration.
- CLE Calculated Life Expectancy (Average)(Days): The machine's estimated full lifespan from new.
- · Severity (Maximum): The maximum severity of any historical data collection at any point/axis
- CLE Calculated Life Expectancy (Minimum)(Days): The estimated days for the machine to deteriorate from green alarm status to red alarm status.
- MTTF Mean Time To Failure (Days): The estimated days remaining until the machine deteriorates from current alarm status to red alarm status.
- Vel (Maximum): The maximum Velocity of any historical data collection at the point/axis.
- Env (Maximum): The maximum Acceleration Envelope value of any historical data collection at the point/axis.

Advance Tendency continued (M20, M30, Phantom)

Severity panel

The Severity panel provides a ring chart overview of current machine health severities, based on the most recent recordings. (0-1=Inoperative, 1-2=Excellent, 2-3=Satisfactory, 3-4=Unsatisfactory, 4-5=Poor)


Ring segments are divided equally among the next lower level of database, beneath the level selected (Areas when a Company is selected, Machines when an Area is selected, etc.). Colors are only intended to distinguish between ring segments. Colors are not an indication of severity or alarm status.

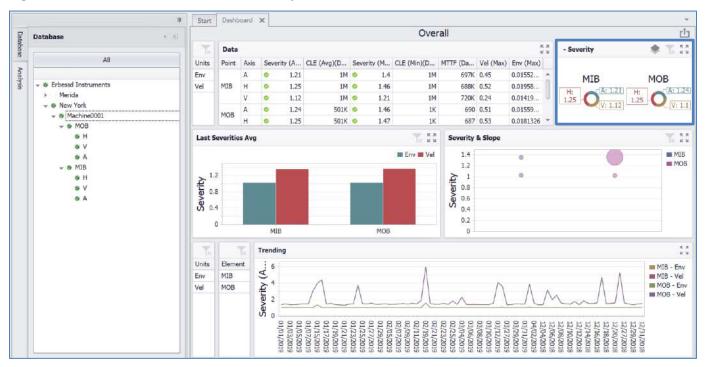

Advance Tendency continued (M20, M30, Phantom)

Last Severities Avg panel


The Last Severity Avg panel provides a bar chart overview of average machine health severities, based on the most recent recordings versus any currently-assigned alarm values: Velocity, Acceleration Envelope, Acceleration and/or Displacement. (0-1=Inoperative, 1-2=Excellent, 2-3=Satisfactory, 3-4=Unsatisfactory, 4-5=Poor)

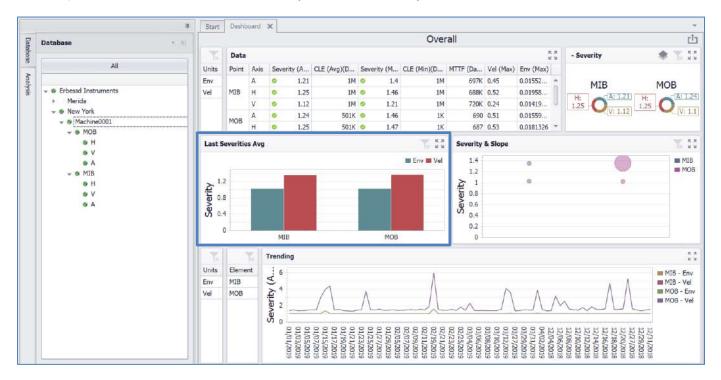

Advance Tendency continued (M20, M30, Phantom)

Severity & Slope panel

The Severity & Slope panel provides a chart overview of average machine health severities and the degree of change between the last two recordings. The circle position on the graph indicates the current severity. The size of the circle indicates the slope of change between the last two recordings (whether increased or decreased). Smaller circles indicate little change between the last two recordings. Larger circles indicate a greater change between the last two recordings. (0-1=Inoperative, 1-2=Excellent, 2-3=Satisfactory, 3-4=Unsatisfactory, 4-5=Poor)

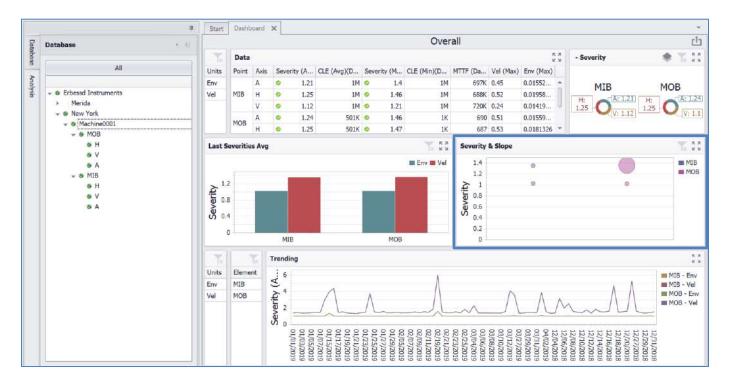

Advance Tendency continued (M20, M30, Phantom)

Trending panel

The Trending panel plots the highest velocity and acceleration envelope severities recorded each day, within the database level selected. (0-1=Inoperative, 1-2=Excellent, 2-3=Satisfactory, 3-4=Unsatisfactory, 4-5=Poor)



Saving and Uploading Data Files

In several functions, DigivibeMX® generates its own files by ordering them in the database, however in the options such as

Generic Analysis and for any equipment. This does not happen since it is not assigned to any equipment. This does not mean that the signals can not be saved. On the contrary, the difference is that you can do it if you want through the toolbar in the File menu - Save or Save As button, or from the context menu - File - Save.

DigivibeMX[®] handles several types of files depending on the function to which they correspond. They will be described below.

File Types

DigivibeMX[®] handles 8 different file types whose extensions are as follows:

Extension	Compatibility	Description
.anl	DigivibeMX®	Files of 1 single channel of vibration analysis.
.anl	DigivibeMX®	2-channel rolling files.
.asc	DigivibeMX®, Block de notas	Text file containing all data in Alpha-Numeric format.
.bal	DigivibeMX®	Balance Calculator session, retrieves all the information entered into the calculator.
.uff	Universal File Format	This file is used by many vibration analysis software and ODS programs.
.wav	Sound file	This file is compatible with any audio software.
.jpg	Pictures viewer	It is used in vibration graphics and polar graphs. It is elective between BMP and JPG
.bmp	Pictures viewer	It is used in vibration graphics and polar graphs. It is elective between BMP and JPG

Saving Files

Save Options:

- **Button** Button Save the file corresponding to the visible session. _
- Button 🔛 Save as.
- Button File menu.
- File menu To export As image: Save the spectrum image. -
- File menu Save Save to Database: Export to specific database. -

Opening Files

Options to open files:

- Button Dens a selected file
- File menu Open: Opens a selected file -
- Double-click the desired file from the database file window: Open the selected database file in a new window.

Phantom Menu Tools

This menu includes many of the necessary tools to set, visualize and create alarms for the Phantom devices.

Phantom Tools

Wizard

Phantom tool that allows a step by step configuration for the sensors. Click the Wizard button to open the Wizard main window and click Next to open the Phantom Configuration:

zard Phantom Configuration												ſ
Select Phantom Enter a Phantom code manually	or by sc	annin	g from the devic	ce,								
Select Phantom												
							Sensor descr	iption:				
AB Manually	Type: Axes: 3	Accele 3	erometer									
ିନ୍ମ Scan Code		: 5.1 - ude ra	- 10 kHz ange: 8G / 16G / 3	32G								
Copy Phantom sensor settings	1000 00000		perature: Yes									
Select a Phantom sensor												
~					Cop	y sele	ted Phantom	n sensoi	settings.			
		D	Interval Send	Axis	A	De	Device Cha	Alar	Alarm	I	Power	 Alarm Condi
No copy any settings												
									< Previous	;	Next>	Cancel

In this window you will be able to register one sensor at a time. You have two options:

- Manually: Allows you to add the sensor with the serial number (including the prefix).
- Scan Code: Allows you to add the sensor with the QR code printed on the label.
- Copy Phantom Sensor Settings: Allows you to copy the exact same configuration of another Phantom sensor.

Once the sensor is added, you will observe a description regarding its type. Then click "Next".

In the next screen you have the option to create a group where the sensors will be organized or you can choose between a previously created group. You can also assign a name and a description for the sensor. In the last option you can define the "Interval send data" (if applicable) for the added sensor. Once that all of your configuration are as desired, click "Next".

rd Phantom Configuration		-
et Phantom		
Configure your Phantom sensor.		Charles and
Organize in a better way your Phantom sensor.		
	Select a group name from the list below or write for create a new group.	
Group	HighRange	•
Name	Motor1	
Description	Triaxial Vibration Sensor	
Interval Send Data	720	×
	< Previous Next>	Cancel

The next screen allows you to assign the sensor to an specific machine point; you can choose between two available point that has not been previously chosen for the same type of sensor that you are adding.

rd Phantom Configuration		
ssing channels		(1) ·
Set an item on the tree		
Channels		
As	sign each channel with an item from the tree.	
You may only assign the levels: point from accelerometer		
	+ 🗌 Pruebas	-
	+ 🔲 Soporte	
	- 🗆 Carlos	
	Punto 1	
	Punto 2	
	Punto 3	
Channel 1	Punto 4	
	Punto 5	
	Punto 6	
	Punto 7	
	Punto 8	
	Punto 9	
	Punto 10	
	< Previous	Next> Cancel

In the next you can set basic configurations depending on the sensor you are currently adding, in this case you can choose the axis orientation of your triaxial sensor, however, you can also choose the value of your current clamps, etc. The next section of this windows you're able to set up the alarmas depending on the parameter you are going to measure with the sensor, also you can define alarms for battey leven and internal temperature. This values can be changed later.

iet Phantom ala Assign alar Phantom s	m to your		Set Phantom Co Set Phantom ala Assign alam Phantom s	rms m to your		Wizard Phantom Co Set Phantom ala Assign alar Phantom s	rms m to your	0
Filantoni s	ensor.		Filantom si	ensor.		Phantom s	ensor.	
Axes confi	iguration		Axes confi	guratior	1	Axes confi	guration	
X axis	[EditValue is null] 🔻		X axis	Horizontal	•	X axis	Horizontal	•
Y axis	[EditValue is null] 🔹		Y axis	Vertical	•	Y axis	Vertical	•
Z axis	[EditValue is null] 🔻		Z axis	[EditValue i	s null] 🔻	Z axis	Axial	•
				value	option			
Alarms			Alarms	1 2	Horizontal Vertical	Alarms		
X axis	0.00		X axis	3	Axial	X axis	10.00	
Y axis	0.00		Y axis	×		// Y axis	15.00	
Z axis	0.00		Z axis	0.00		Z axis	18.00	
Internal Temp	0.00		Internal Temp	0.00		Internal Temp	0.00	-
Battery	0.00		Battery	0.00		Battery	0.00	*
< Previous	Next> Canc	el	< Previous	Next>	Cancel	< Previous	Next>	Cancel

When the sensor is completely set with the desired configurations, click "Next". The final window will pop up where you will see a summary of the information of the sensor you just configured. Click "Finish" and the Wizard will close.

Wizard Phantom Configuration	1	x
	Completing Phantom configuration	
	Wizard has successfully completed	
	HighRange High Range Accelerometer Motor1-123456789	*
	< Previous Finish Cance	1

Status

Tool that shows and overview of the sensors added to the database. The window shows name, type, sensor temperature, battery, assigned machine, etc.

Group	Prueba	-	F		ALL	13x -13x	-\{ ² x	In	c 💧	TP		4	\cap	30			
• Erbessd					wader here of												
			Devic	e	Device Typ	e Device Code	Device Name	Bath	ery Leve	Теп	peratur	Last Update	Machine Na.	Point Neme	Gallery	Edit	Alarm Status
			•	17	Accelerome	888888888	Rotor1	8	0	0	1	2020-02-17.	-	1	Prueba	Edit	Show
				12	Accelerome	123456789	VIb LR	C.	Ō	0	A	2020-02-17	Maquina01	Point 1	Prueba	Edit	Show
				-17	Accelerome	123456789	Vib HR	0	Ō	0		2020-02-17	-		Prueba	Edit	Show
				17	Accelerome	123456789	VID B	0	0	0	A	2020-02-17	. u	-	Prueba	Edit	Show
				1	Temperatur	r 123456789	Temp NC	ō.	Ō	0	A	2020-02-17	2	-	Prueba	Edit	Show
				1	Temperatu	r 123456789	Temp TP	0	0	ũ	D.	2020-02-17	2	14	Prueba	Edit	Show
				1	General Pur	r 123456789	GPIO 420 T	0	0	0	A	2020-02-17	-	-	Prueba	Edit	Show
				L	General Pu	123456789	GPIO Dig T	0	0	0	A	2020-02-17	÷	÷	Prueba	Edit	Show
				1	General Pu	r. 123456789	GPIO T	Q	0	σ	A	2020-02-17	Maguna02	Point 1	Prueba	Edit	Show
				4	Current	123456789	Amp	٥	0	٥	A	2020-02-17	-	-	Prueba	Edit	Show
				0	RPM	123456789	Velocidad	0	Ō	۵	A	2020-02-17	2	12	Prucba	Edit	Show
				(<)	General Pu	r. 123456 <i>7</i> 89	GPID	0	0	Ø	風	2020-02-17	Maquina02	Point 1	Prueba	Edit	Show
				0	General Pu	123456789	GPIO 420	0	Ō	a	A	2020-02-17		-	Prueba	Edit	Show
				3	General Pu	r. 123456789	GPEO Dig	0	ñ	0	A	2020-02-17.	-	+	Prueba	Edit	Show

Signal Strength

The Signal Strenght option shows the quality of the connection for the Phantom device detected by the Gateway. Clicking the icon will display a wizard with the list of sensors and their checkbox. Selecting any of these (it can be more than one) will show the signal value of each individual sensor or sensors expressed in decibels, where a signal closer to 0 will be a stronger signal.

Signal Strength			
If your computer is on the same net phantom code and see the signal str network but the list is not full you ma	ength of each one, i	f you are on	the same
Search Phantom	999999047	-22	(° <mark>1</mark> *)
999999047 189249203 189245643	189249203	-72	((-))
. 105243043			

Set Up Tools

Add GPIO Sensor

It's a useful tool to collect data through GPIO sensors, you can set up the 4mA to 20mA and de 0V to 5V sensors. It allows personalized units configuration with parameters defined by the user. With the blue plus sign it's possible to access to that option.

Sensors for GPIO	_ _ X	Sensors for GPIO	
		@ 4-20mA 0 0-5 V	
Sensor	Parameters	Sensor	Add Unit
Type Sensor Accelerometer Name Sensor Accelerometer Unit G	4	Type Sensor Accelerometer	Unit Parameter Descripton Cancel Add Unit
Calculator		Calculator	
mA Value 10 🗘	Result 250 G	mA Value 4 🛟	Result 0 G
	Add Cancel		Add Cancel

Power Off Configurations

With this tool it's possible to choose under what circumstances the sensors are required to be active. The New button allows to create the power off parameters of the sensors selected from the list. The blue plus sign allows to create a personalized unit. Once that the power off parameters are set, clck Save and the settings will be assigned to the sensor.

Power Off Configurations	- D X
Search	Parameter
Select All S88888888 123456789	New New
	Edit
Configuation	Delete
	Save Close

ower Off Configurations $-\sqrt{3X}$ $-\sqrt{3X}$ $-\sqrt{2X}$ INC	TP	40			- 1- 1 3
Search Code		Unit			
Select All 888888888 123456789	3	Velocity Temperature Amperage Speed	Name	Rotor 1	
			Value	550	inch/s
Configuation				Add	Cance

Alarm Notifications

With this window it's possible to choose minimum alarm values for sensors that are assigned to a machine. The alarm options to choose are Higher tha, Equal to and Lower than for the values defined in the axis boxes.

-	Code Scan	ually	
1	Sensor		Higher than
	Accelerometer Low. Accelerometer High. Accelerometer High. Accelerometer Biaxie Temperature Non Temperature Non Accelerometer Tem. General Purpose T Current GRPM	al	C Equal
	General Purpose General Purpose General Purpose 4	+	Delete 🕜 Apply

Note: The Vibration and GPIO sensor can measure both their designated parameters and temperature as well. The alarms for the temperature are set separately and you can find a subsection in the alarm setup named "Accelerometer Temperature" and "General Purpose temperature" whichever the case.

Reports (M30, M20, M10)


To create reports on DigivibeMX[®] software, click on the New Report button from the Star Menu. Immediately will open the Report Manager Window, here you can select the Machines and the Points on which the report will be generated. Also it is possible to choose the preferred units for the values of the report and you can select to show a spectrum per point.

	Options		
Erbessd Instruments MID	Dates	Spectrum	
	Activate filter per date Start Date:	Show spectrum per point FFT Maximum per point All axis	ht Frequency / Zoom CPM Zoom: Hz 1000 V
 FRESA02- TOP Crua HERR01- Esmeril HERR02- Sierra Taladro de banco TORN01- FREJO TORN02- TOPWY Ventilador 01- C 	Available Units	Actions	Generate report
Ventilador 01- C Ventilador 02- T Ventilador 03- F	Choose Report		
Ventilador 04- S Ventilador Solda Erbessd Mérida	Default Template	Customize Template	a Blank Template
CamalaComannu *	Export To PDF		Cancel

Once that the selected options are correct, click on the Machine button to open the El Report Designer. The El Report Designer allows to modify the content of the report through various tools. The left panel includes tools to add visual elements to the report such as text boxes, images, shapes, forms, graphs, etc.

			XRHachines - Repo	t Designer			M Designer A Prestew 75 Scr
Copen Save Save A	I Add Data		Times New Roman • 9.75 B I U S • A Font		EI III EI EI E V · E · .		abCcDd AaBbCcDd v
XRMachines X	Derta	Cipoda d	- Pers	Androitent		Report Ecolorer	ziyici y
	 ReportHeader1 [sine band pe 	E	RBESSD INSTRU		i i i i i i i i i i i i i i i i i i i	KRMachines MonoMarginBand1 Mexaptriteand1 BeportHeader1 BetaReport2 ElecteReport DetaReport DetaReport Styles	d1
	evel 1	Table of	content	#		EIRow	Endi List
	Level (Default)						
		<u>Machi</u>	nes 🛛			XRMachines Report	D 4
	* 🗐 detailBandl Machines.Company_	Name] - [Machine	es.Area_Nam			Background Color	ii ₹ ★ ø•
5 and Sort				1		Background Color Border Color	() ·
the second s	id a Sort 👻 Delete 🛛 💮 Mov	: Up 🕕 Move Down				Border Dash Style	
Field Name	Sort Order	Show Header Sh	ow Footer			Border Width	() s :
Taron anno -	 Ascending 	0				Borders	🗉 🛅 स न स छ
Area_Name MachineName	Ascending Ascending					Background Color Gets or sets the control's ba	ickground color.
Group and Sort	icripts Errors					Properties 10 Rep	out Galery

The lower panel includes the necessary tools to manage the data shown in the report. Clicking the Add Group and Add Sort buttons allows to select the required data form the dropdown menu. This data con also be Deleted or change the level or priority with the Move Up and Move Down buttons.

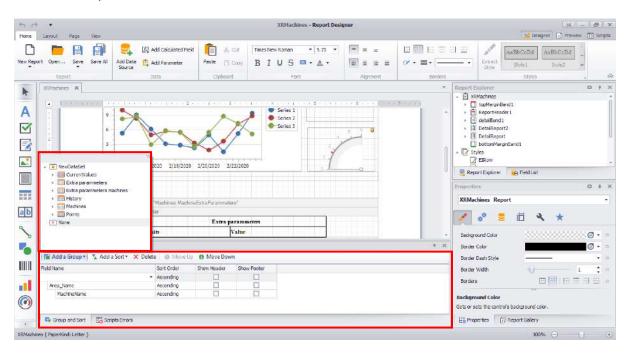

The El Report Designer includes tools menu that allows to customize the report. The Home menu includes the tools:

- **Report Tools:** It allows to manage the save options of the report or to open a previous report.
- **Data Tools:** It allows to add analysis parameters an also a database source to select the data needed to generate the report.
- Clipboard Tool: Copy, cutting and pasting tools to add external or internal elements.
- Font Tool: Basic tools for the report text style.
- Alignment Tool: Allows to modify the text order of the report.
- Borders Tool: Allows to create bold borders on the report cells.
- Style Tools: Allows to choose a predefined style text between the lists of styles of the system.

50	Ŧ						XRMachines - Report Desig	iner			34	_ 67 ×
Home L	ayout	Page	View								🚺 Designer 🔂 Previ	ievi 💽 Scripta
C			A	2	Add Calculated Reld	tio K 📄	Times New Roman 🔻 9.75 🔹	= = =	8888	ATA	AaBbCeDd AaBbCeDd	
New Report	Open	Save	Save Al	Add Data Source	🛐 Add Parameter	Paste 🗐 Copy	BIUS . A.	E 3 B	¤ • ■••	Extract Style	Style1 Style2	=
	Report	E.			Data	Clipboard	Font	Alignment	Borders		Styles	

The Design Menu includes the tools:

- Alignment Tools: Allows to modify of the graph data from its center.
- Layout Tools: Allows to modify and manage the quantity and space of the rows and columns of a chart.
- Page Tools: Organizes elements of the report and allows overlapping them.
- Snapping Tools: It allows to snap elements from the report on the grid lines.

↔ ;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;			XRMachines - Report Designer	X _ 67 ×	
Home Layo	ut Page View			Designer 🕞 Preview 🗃 Scripts	
15. 21. 21		5 8	Snap to Grid		
म न त	Align Fil Bounds Fil Bounds 을 좀 좀 봅는 몸는 또 또	Bring to Send to Front Back	Shap Lines		
Algoment	Lavout	Arrangeo	Snapping	۵	

The Page Menu includes the tools:

- Page Setup Tools: Allows basic editing of the report page-
- Appearance Tools: Allows changing the color of the page and adding a watermark.

50	e 😐			XRMachines - Report Designer	X # X
Home	Layout	Page	View		🔰 Designer 📄 Preview 🗔 Scripts
Margins	Orientation	Size	Page Color Watermark		
	Page Setup		Appearance		A

The View Menu includes the tools:

- **Show Tools:** Changes the report to a printing view.
- **Zoom Tools:** Changes the zoom of the report pages.
- View Tools: Changes the available windows of the Report Designer.

↔ ↔ •							XRMachines - Report Designer	- (#) ×
Home	Layout	Page View					🛃 Designer 🕞 Preview	💽 Scripta
E		🕞 Watermark	Q	9	Ð			
Printing Warnings	Export Warnings	Grid Lines	Zoom Out	Z00m	Zoom In	Windows •		
	Shiwa			Zoom		View		\$

Product Registration

DigivibeMX[®] is a registered trademark and therefore requires an activation via the internet that can be made using the "Registry" option in the "Help" menu. It is essential to carry out this operation as otherwise the program could be suddenly deactivated.

<u>Updates</u>

DigivibeMX[®] is an application that is constantly updated. These updates are published on the Erbessd Instruments[®] page and are free to all users of Erbessd Instruments within the installed version.

<u>License</u>

DigivibeMX[®] is distributed with the license to use the software in a single equipment, reason why is prohibited any total or partial reproduction of said software, as well as the unauthorized distribution of the same one.

Security and Copyright ©

DigivibeMX[®] is distributed without a registration code because it is part of a set of parts, however each edition of DigivibeMX[®] is compiled with the data of the company and the person to whom it has been delivered, which does not prevent its operation but is Will use to track the source of illicit software on the internet. The owner of the software that is unlawfully distributed will be liable to the corresponding legal penalties for illicit distribution of copyrighted material. Also, all the updates for that edition will be canceled.